

Engineer: David Hasz  
Cell Phone Number: 970-371-8820

## PLUG and ABANDONMENT PROCEDURE

### **P&M PALOMBO UNIT 1**

#### Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline . Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run on 10/30/2014. RDMO Slickline .
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a min of 40 jts of 2.375" 4.7#, J-55, EUE tbg. Kill well as necessary using clean fresh water with biocide. ND WH. NU BOP. Unland tbg using unlanding joint and LD.
7. TOO H and SB all 2.375" tbg.
8. PU and TIH with (5.5", 17#) Bit and Scraper on 2.375" tbg to 7690'. TOO H and SB 7690' 2.375" tbg. LD bit & scraper.
9. MIRU WL. PU and RIH with (5.5", 17#) CIBP and set at +/- 7680' (collars at 7668' & 7710'). POOH. RDMO WL
10. MIRU hydrotesters. TIH with 2.375" tbg to 7680' while hydrotesting to 3000 psi. RDMO hydrotesters.
11. Load hole with biocide treated fresh water and circulate all gas out of well. PT CIBP to 500psi for 15 minutes.
12. MIRU Cementers. Pump Niobrara Balance Plug: Pump 95 sxs (148cf), assuming 15.8 ppg & 1.55 cf/sk. Volume based on 400' inside 5.5", 17# production casing with no excess. Cement will be from 7680'-6610'. RD cementers.
13. Slowly pull out of the cement while TOO H to 4820'. LD any remainder.
14. Establish circulation to surface with biocide treated fresh water.
15. RU Cementers. Pump Sussex Balance Plug: Pump 95 sx (112 cf), assuming 15.8 ppg & 1.17 cf/sk. Volume is based on 810' inside 5.5", 17# production casing with no excess. Cement will be from 4820'-4010'. RD cementers.
16. Slowly pull out of the cement and TOO H to 3510'. Reverse circulate to ensure no cement is left in the tbg.
17. TOO H and SB 980' of 2.375" tbg. LD remaining tbg.
18. RIH and run CBL from 2000' to surface. Forward CBL to Platteville office. Jet cut and cementing plans may change depending on CBL results.
19. MIRU WL. Tag cement. Cement top needs to be at or above 4017' (200' above Sussex top at 4217'). Call engineering if tag is lower than 4017'.

20. RIH and jet cut 5.5", 17# casing at 320'. RDMO WL.
21. Attempt to establish circulation and circulate (21 bbl) with fresh water containing biocide to remove any gas.
22. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
23. Install BOP on casing head with 5.5", 17# pipe rams.
24. TOOH and LD all 5.5", 17# casing. Remove 5.5", 17# pipe rams and install 2.375" pipe rams.
25. TIH with mule shoe and 2.375" tubing to 980'.
26. Establish circulation with biocide treated fresh water and pump one hole volume (36 bbl).
27. RU Cementers. Pump Stub Plug: 140 sxs (163 cf) assuming 15.8 ppg & 1.16 cf/sk. Volume is based on 660' in 5.5", 17# production casing with no excess, and 200' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 980'-120'. RDMO cementers. Notify engineering if circulation is ever lost during job.
28. Slowly pull out of the cement and TOOH to 100'. Reverse circulate using biocide treated fresh water, to ensure the tubing is clean. TOOH, LD all 2.375" tbg.
29. MIRU WL. Tag cement as needed. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
30. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to [rscDJVendors@anadarko.com](mailto:rscDJVendors@anadarko.com) within 24 hours of completion of the job.
31. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
32. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
33. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
34. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
35. Welder cut casing minimum 5' below ground level.
36. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
37. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
38. Obtain GPS location data as per COGCC Rule 215 and send to [rscDJVendors@anadarko.com](mailto:rscDJVendors@anadarko.com).
39. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
40. Back fill hole with fill. Clean location, and level.
41. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.