

PLUG and ABANDONMENT PROCEDURE

DEWALT 19-42

Step	Description of Work
------	---------------------

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was ran on 2/3/15. RD slickline.
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a min of 25 jts of 2-3/8" 4.7# J-55, EUE tbg. Kill well as necessary using clean fresh water with biocide. ND WH. NU BOP. Unland tbg using unlanding joint and LD.
7. TOOH and SB 6950' 2-3/8" tbg. LD any remainder.
8. MIRU WL. PU and RIH with (4.5", 11.6#) gauge ring to 6960'.POOH.
9. PU and RIH with (4.5", 11.6#) CIBP and set at +/- 6950' (collars at 6930' & 6970') to abandon the Nio/Codell. POOH. SB WL.
10. TIH with 2-3/8" tbg to 2500'. Load hole with biocide treated fresh water and circulate all gas out of well. TOOH and SB 2-3/8" tbg.
11. RU WL. RIH and run CBL from 6950' to surface. Forward CBL to Platteville office. Cementing plans may change depending on CBL results. RDMO WL. MIRU hydrotesters. TIH with 2-3/8" tbg to 6950' while hydrotesting to 3000 psi. RDMO hydrotesters. PT CIBP to 1000 psi for 15 minutes.
12. MIRU cementers. Pump Niobrara Balance Plug: Pump 40 sx (62 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 628' inside 4-1/2" production casing with no excess. Cement will be from 6950'-6320'. RD cementers.
13. Slowly pull out of the cement. LD tbg while TOOH to 4060'.
14. Establish circulation to surface with biocide treated fresh water.
15. RU Cementers. Pump Sussex Balance Plug: Pump 25 sx (39 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume is based on 400' inside 4-1/2" production casing with no excess. Cement will be from 4060'-3660'. RD cementers.
16. Slowly pull out of the cement and TOOH to 3160'. Reverse circulate to ensure no cement is left in the tbg.
17. TOOH and SB 650' 2-3/8" tbg. LD remaining tbg.
18. MIRU WL. RIH and tag cement as needed. RDMO WL.
19. Establish circulation with biocide treated fresh water and pump one hole volume (60 bbl). Pump 10 bbls (min) SAPP, followed by 5 bbls fresh water spacer.
20. RU Cementers. Pump Stub Plug: 25 sx (38 cf) with 15.8 ppg & 1.50 cf/sk (350' into the 4-1/2" casing). The plug is designed to cover 650'-300' RDMO cementers. Notify engineering if circulation is ever lost during job.

Engineer: Savanna Riebe

Cell: 970-714-0288

PLUG and ABANDONMENT PROCEDURE

DEWALT 19-42

21. Slowly pull out of the cement and TOO H to 100'. Reverse circulate using biocide treated fresh water, to ensure the tubing is clean. TOO H, LD all 2-3/8" tbg.
22. MIRU WL. Tag cement as needed. RIH 4-1/2" 11.6# CIBP to 80'. RDMO WL and WO rig.
23. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
24. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
25. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
26. Capping crew will set and secure night cap on 8 5/8" casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
27. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
28. Welder cut casing minimum 5' below ground level.
29. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
30. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
31. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
32. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
33. Back fill hole with fill. Clean location, and level.
34. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.