

WORKOVER PROCEDURE

WELL NAME: Peppler PC AA17-25 **DATE:** 11/23/2016
LOCATION:
Qtr/Qtr: SESW Section: 17 Township: 6N Range: 63W
Footages: 1300' FSL & 1380' FWL
COUNTY: WELD **STATE:** CO **API #:** 05-123-32108

ENGINEER: Narayan Choudhary 7 Day Notice Sent: _____
(Please notify Engineer of any major Do not start operations until: _____
changes prior to work) Notice Expires: _____

OBJECTIVE: P&A

WELL DATA: Surface Csg: 8 5/8" 24# J-55 @ 575' KB Elevation: 4681'
Surface Cmt: 329 sks GL Elevation: 4667'
Long St Csg: 4 1/2" 11.6# M-80 @ 6951' TD: 6961'
Long St Cmt: 550 sks PBTD: 6817'
Long St Date: 1/25/2011

Plug Back (Sand or CIBP): _____
Perforation Interval (1): Niobrara Perforations 6470' - 6482'
Perforation Interval (2): Codell Perforations 6762' - 6774'
Perforation Interval (3): _____
Tubing: 2 3/8" 4.7# J-55 @ 6744' Rods: _____
Pump: _____
Misc.: _____

PRODUCTION STATUS: SI
COMMENTS: _____

PROCEDURE:

- 1) Perform Form 17 if needed.
- 2) MIRU Workover rig, pump & tank.
- 3) POOH w/ 2 3/8" tbg and lay down.
- 4) RU WL. RIH w/ CIBP. Set CIBP @6420', dump bail 2 sx of cement on top.
- 5) RIH w/ workstring to pump 20 sx courtesy plug @ 2500' (top of plug 2200').
- 6) Unland casing (if able). Cut casing off (in slips if unable to unland) @ 675'. POOH w/ casing laying down on trailer.
- 7) RIH w/ workstring to 675'. Pump 210 sx shoe plug. Cement to surface.
- 8) SI, WOC. RIH. Tag shoe plug. Add cement if needed.
- 9) Cut surface casing off 6'-8' below ground.
- 10) Clean up location. Reclaim location. RDMO.