

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

11/02/2016

Submitted Date:

11/17/2016

Document Number:

678200519**FIELD INSPECTION FORM**
 Loc ID 317072 Inspector Name: YOUNG, ROB On-Site Inspection ☐ 2A Doc Num:
Operator Information:OGCC Operator Number: 10330Name of Operator: INVESTMENT EQUIPMENT LLCAddress: 412 W PLATTE AVECity: FT MORGAN State: CO Zip: 80701**Status Summary:**

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☐ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:2 Number of Comments1 Number of Corrective Actions☒ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
Axelson, John		john.axelson@state.co.us	
Rebol, Dave		daverebol@hotmail.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
107671	PIT	AC			-	HUBBIRD BOSTON BATTERY	EI
107672	PIT	AC			-	HUBBIRD BOSTON BATTERY	EI
107673	PIT	AC			-	HUBBIRD BOSTON BATTERY	EI

General Comment:

Environmental inspection. Secondary containment around oil skim tank requires improvement especially on the north side in order to provide sufficient containment of potential spills. Additional weed control effort should be made during the next growing season to prevent excessive weed growth on the pit berms.

Inspected Facilities

Facility ID:	<u>107671</u>	Type:	<u>PIT</u>	API Number:	<u>-</u>	Status:	<u>AC</u>	Insp. Status:	<u>EI</u>
--------------	---------------	-------	------------	-------------	----------	---------	-----------	---------------	-----------

Facility ID:	<u>107672</u>	Type:	<u>PIT</u>	API Number:	<u>-</u>	Status:	<u>AC</u>	Insp. Status:	<u>EI</u>
--------------	---------------	-------	------------	-------------	----------	---------	-----------	---------------	-----------

Facility ID:	<u>107673</u>	Type:	<u>PIT</u>	API Number:	<u>-</u>	Status:	<u>AC</u>	Insp. Status:	<u>EI</u>
--------------	---------------	-------	------------	-------------	----------	---------	-----------	---------------	-----------

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: Oil skim tank secondary containment berms insufficient to control potential spills.

Corrective Action: Improve oil skim tank secondary containment berms sufficiently to control potential spills.

Date: 12/23/2016

Pits: ☐ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
678200519	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4006053
678200520	Oil skim tank insufficient secondary containment	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4005985
678200521	Excessive weed growth on pit berms, view S	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4005986