

FORM
6

State of Colorado
Oil and Gas Conservation Commission



DE	ET	OE	ES
----	----	----	----

Rev 12/05 1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109

Document Number:
401146577

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Kelsi Welch
 Name of Operator: PDC ENERGY INC Phone: (303) 831-3974
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: kelsi.welch@pdce.com

For "Intent" 24 hour notice required, Name: Gomez, Jason Tel: (970) 573-1277
 COGCC contact: Email: jason.gomez@state.co.us

API Number 05-123-20075-00
 Well Name: BETH Well Number: 1
 Location: QtrQtr: NENE Section: 14 Township: 5N Range: 65W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.405140 Longitude: -104.623500
 GPS Data:
 Date of Measurement: 10/16/2010 PDOP Reading: 3.0 GPS Instrument Operator's Name: Steve Cure
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6935	6945			
NIOBRARA	6634	6835			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	374	360	374	0	
1ST	7+7/8	4+1/2	11.6	7,102	650	7,102	0	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6885 with 2 sacks cmt on top. CIBP #2: Depth 6584 with 2 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 60 sks cmt from 575 ft. to 0 ft. Plug Type: CASING Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)
 Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Beth 1 (05-123-20075)/Plugging Procedure (Intent)
 Producing Formation: Codell 6935'-6945' Niobrara 6634'-6835'
 TD: 7110' PBDT: 7077'
 Surface Casing: 8 5/8" 24# @ 374' w/ 360 sxs
 Production Casing: 4 1/2" 11.6# @ 7102' w/650 sks cmt (TOC at Surface – CBL)

Tubing: 2 3/8" tubing set at 6913'. (7/21/2006)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set CIBP at 6885'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with CIBP. Set CIBP at 6584'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with tubing to 575'. Mix and pump 60 sxs of 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kelsi Welch
 Title: Production Tech Date: _____ Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

401156198	WELLBORE DIAGRAM
401156199	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)