

Plugging Procedure

Blue Chip Oil Inc. - Leistikow #1 - NESW 21-1N-68W 6PM - Boulder County, CO

API 05-013-06483
KB: 5159' GL: 5148'
8 5/8" 24# csg 526'
4 1/2" 12.6# csg @ 8029'
Perforations: 7426' – 7886'

Procedure for the Leistikow #1 (API 05-013-06483) is as follows:

1. Load hole with water.
2. RU BOP.
3. Pull and lay down tubing leaving 78 stands in derrick.
4. Set CIBP at 7330' (96' above perforations), place 2 sxs cmt on CIBP with wireline dump bailer.
5. Pull and lay down tubing.
6. Fill hole if necessary.
7. Perforate @ 600' KB, establish circulation.
8. Cement down 4 1/2" csg through perforations until cement reaches surface in annulus (approximately 175 sxs).
9. RD cementers, clean hoses & equipment.
10. Flush flow line with water.
11. Top off cement in 4 1/2" casing if necessary.
12. Rig down, move out rig.
13. Cut off casing strings at 4', weld on cap with weep hole.
14. Clean up location.