

FORM  
6Rev  
12/05

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401157971

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Kelsi Welch

Name of Operator: PDC ENERGY INC

Phone: (303) 831-3974

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: kelsi.welch@pdce.com

**For "Intent" 24 hour notice required,**

Name: Gomez, Jason

Tel: (970) 573-1277

**COGCC contact:**

Email: jason.gomez@state.co.us

API Number 05-123-19316-00

Well Name: SILVA

Well Number: 23-6

Location: QtrQtr: NESW Section: 6 Township: 5N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 56553

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.425970

Longitude: -104.594860

GPS Data:

Date of Measurement: 09/08/2010

PDOP Reading: 2.0

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 600

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6880	6890			
NIOBRARA	6708	6714			

Total: 2 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	371	260	371	0	
1ST	7+7/8	3+1/2	903	7,100	320	7,100	6,180	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6830 with 2 sacks cmt on top. CIBP #2: Depth 6658 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 28 sks cmt from 3750 ft. to 3100 ft. Plug Type: CASING Plug Tagged: ☐  
Set 200 sks cmt from 650 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Silva 23-6 Plugging Procedure (Intent)  
API: 05-123-19316

Producing Formations: Nio: 6708'-6714'

Codell: 6880'-6890'

TD: 7100' PBTD: 7070'

Surface Casing: 8-5/8" 24# @ 371' w/ 260 sks

Production Casing: 3-1/2" 9.3# @ 7100' w/ 320 sks cmt (TOC @ 6180', 3640' - CBL)

Tubing: 1.9" tubing set at 6867' (1/31/2013)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 1.9" tubing.
2. RU wireline company.
3. TIH with CIBP. Set CIBP at 6830'. Top with 2 sks 15.8#/gal CI G cement.
4. TIH with CIBP. Set CIBP at 6658'. Top with 2 sks 15.8#/gal CI G cement.
5. TIH with tubing to 3750'. Mix and pump 28 sks balance plug of 15.8#/gal CI G cement down tubing.
6. TIH with casing cutter. Cut 4 1/2" casing at 600'. Pull cut casing.
7. TIH with tubing to 650'. Mix and pump 200 sks of 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_

Print Name: Kelsi Welch

Title: Production Tech

Date: \_\_\_\_\_

Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

<u>COA Type</u>	<u>Description</u>

**Attachment Check List**

<u>Att Doc Num</u>	<u>Name</u>
401163568	WELLBORE DIAGRAM
401163569	WELLBORE DIAGRAM
401163570	CEMENT BOND LOG

Total Attach: 3 Files

**General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)