

**FORM
INSP**

Rev
X/15

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:
11/29/2016
Submitted Date:
12/02/2016
Document Number:
682401572

FIELD INSPECTION FORM

Loc ID 440192 Inspector Name: Binschus, Chris On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 10611
Name of Operator: LONGS PEAK RESOURCES LLC
Address: 2323 S SHEPHERD SUITE 1150
City: HOUSTON State: TX Zip: 77019

Findings:

5 Number of Comments
0 Number of Corrective Actions
 Corrective Action Response Requested

Contact Information:

Contact Name	Phone	Email	Comment
		egeiser@juncap.com	
		kpeters@juncap.com	
		dclarkson@vrtxep.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
440182	WELL	XX	10/18/2016	LO	123-40719	Pismo East 35-2-2-4CH	CI
440186	WELL	XX	10/18/2016	LO	123-40723	Pismo East 35-2-2-2CH	CI

General Comment:

This is a construction and stormwater inspection in response to Form 42 Document #401147916- Notice of construction of a new location.

Location Construction

Location ID: 440186 CDP: _____

Comment: Topsoil shall be protected from degradation due to contamination, compaction and, to the extent practicable, from wind and water erosion during drilling and production operations. Best management practices to prevent weed establishment and to maintain soil microbial activity shall be implemented. Topsoil stockpile has been stored and separated along the eastern location. Need to stabilize topsoil stockpile from degradation due to wind and water erosion per Rule 1002.c.

Corrective Action: _____ Date: _____

Form 2A COAs:

Comment: _____

Corrective Action: _____ Date: _____

Wildlife BMPs:

Comment: _____

Corrective Action: _____ Date: _____

Stormwater:

Erosion BMPs	Present	Other BMPs	Present
--------------	---------	------------	---------

RETENTION PONDS	Yes		
-----------------	-----	--	--

Comments: Erosion BMPs: Sediment trap installed at northeast corner of location. Sediment trap side slopes should not be steeper than 2:1 and the inlet and outlet should be stabilized. Berms around sediment trap have been stabilized.

Other BMPs:

Corrective Action: _____ Date: _____

DITCHES	Yes		
---------	-----	--	--

Comments: Erosion BMPs:

Other BMPs:

Corrective Action: _____ Date: _____

BERMS	Yes		
-------	-----	--	--

Comments: Erosion BMPs: Berm shall be compacted to ensure containment of sediment laden storm runoff is directed to the sediment trap.

Other BMPs:

Corrective Action: _____ Date: _____

Comment:

Corrective Action: **Date:** _____

On Site Inspection (305):

Surface Owner Contact Information:

Name: _____ Address: _____

Phone Number: _____ Cell Phone: _____

Operator Rep. Contact Information:

Landman Name: _____ Phone Number: _____

Date Onsite Request Received: _____ Date of Rule 306 Consultation: _____

Request LGD Attendance: _____

LGD Contact Information:

Name: _____ Phone Number: _____ Agreed to Attend: _____

Summary of Landowner Issues:

Summary of Operator Response to Landowner Issues:

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

Inspected Facilities

Facility ID: 440182 Type: WELL API Number: 123-40719 Status: XX Insp. Status: CI

Facility ID: 440186 Type: WELL API Number: 123-40723 Status: XX Insp. Status: CI

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
682401572	INSPECTION APPROVED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4022990
682401573	Location Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4017326