

FORM  
6Rev  
12/05

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401164724

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: DOREEN GREEN

Name of Operator: KERR MCGEE OIL &amp; GAS ONSHORE LP

Phone: (970) 336-3517

Address: P O BOX 173779

Fax:

City: DENVER State: CO Zip: 80217-

Email: DOREEN.GREEN@ANADARKO.COM

For "Intent" 24 hour notice required,

Name:

Tel:

COGCC contact:

Email:

API Number 05-123-17445-00

Well Name: UPRC

Well Number: 19-15L

Location: QtrQtr: SWSE Section: 19 Township: 3N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☐ Notice of Intent to Abandon☒ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.206657

Longitude: -104.929652

GPS Data:

Date of Measurement: 07/07/2014

PDOP Reading: 6.0

GPS Instrument Operator's Name: RH

Reason for Abandonment:

☐ Dry☐ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☐ No

Estimated Depth:

Fish in Hole: ☐ Yes☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☐ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7222	7232	10/31/2016	B PLUG CEMENT TOP	7155

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	428	200	428	0	VISU
1ST	7+7/8	3+1/2	7.7	7,407	715	7,407	3,510	CBL
S.C. 1.1				7,407	235	1,009	290	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7155 with 20 sacks cmt on top. CIBP #2: Depth 80 with 32 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>20</u> sks cmt from <u>7155</u> ft. to <u>6564</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input type="checkbox"/>
Set <u>28</u> sks cmt from <u>4500</u> ft. to <u>3674</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input checked="" type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 76 sacks half in. half out surface casing from 1000 ft. to 100 ft. Plug Tagged: ☒

Set 32 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: 260 ft. of 3+1/2 inch casing

Plugging Date: 11/15/2016

\*Wireline Contractor: RELIANCE

\*Cementing Contractor: SCHLUMBERGER

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No

\*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_

Print Name: DOREEN GREEN

Title: REGULATORY ANALYST

Date: \_\_\_\_\_

Email: RSCDJPOSTDRILL@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

### CONDITIONS OF APPROVAL, IF ANY:

#### COA Type

#### Description

--	--

### Attachment Check List

Att Doc Num

Name

401164725	OPERATIONS SUMMARY
401164726	WIRELINE JOB SUMMARY
401164727	CEMENT JOB SUMMARY
401164728	WELLBORE DIAGRAM

Total Attach: 4 Files

### General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)