

Engineer: Savanna Riebe
Cell Phone Number: 970-714-0288

PLUG and ABANDONMENT PROCEDURE

VYNCKIER DONALD GU 1

- | Step | Description |
|------|--|
| 1. | Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU. |
| 2. | MIRU Slickline . Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was ran in 3/18/14. RDMO Slickline . |
| 3. | Prepare location for base beam equipped rig. Install perimeter fence as needed. |
| 4. | Verify COAs before RU. |
| 5. | Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi. |
| 6. | MIRU WO rig. Spot a min of 50 jts of 2-3/8" 4.7#, J-55, EUE tbg. Kill well as necessary using clean fresh water with biocide. ND WH. NU BOP. Unland tbg using unlanding joint and LD. |
| 7. | TOOH and SB 7195' 2-3/8" tbg. LD any remaining tbg. |
| 8. | PU and TIH with (4-1/2", 10.5#) Bit and Scraper on 2-3/8" tbg to 7195'. TOOH. |
| 9. | MIRU WL. PU and RIH with (4-1/2", 10.5#) CIBP and set at +/- 7185' (collars at 7165' & 7210'). POOH. RDMO WL. |
| 10. | TIH with 2-3/8" tbg to 7185' . Load hole with biocide treated fresh water and circulate all gas out of well. TOOH and SB 2-3/8" tbg. |
| 11. | MIRU WL. RIH and run CBL from 4200' to surface. Forward CBL to Platteville office. Cementing plans may change depending on CBL results. RDMO WL. MIRU hydrotesters. TIH with 2-3/8" tbg to 7185' while hydrotesting to 3000 psi. RDMO hydrotesters. PT CIBP to 500psi for 15 minutes. |
| 12. | MIRU Cementers. Pump Niobrara Balance Plug: Pump 25 sxs (39cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 425' inside 4-1/2", 10.5# production casing with no excess. Cement will be from 7185'-6760'. RD cementers. |
| 13. | Slowly pull out of the cement and TOOH to 6260'. Reverse circulate using biocide treated fresh water, to ensure the tubing is clean. TOOH and SB 3730' of 2-3/8" tbg. LD remaining tbg. |
| 14. | MIRU WL. PU and RIH with two 3-1/8" perf guns with 3 spf, min 0.5" EHD, 120° phasing. Shoot 2' of squeeze holes at 4100' and 4' of squeeze holes at 3700'. RDMO WL. |
| 15. | PU and TIH with (4-1/2", 10.5#) CICR on 2-3/8" tbg. Set CICR at 3730'. |
| 16. | Establish circulation to surface with biocide treated fresh water, and pump 100 bbls to clean up hole. |
| 17. | RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water space. Pump Sussex Squeeze: 150 sxs (227cf) with 0.25 lb/sk polyflake, assuming 15.8 ppg & 1.51 cf/sk. Underdisplace by 3 bbls. Volume is based on 370' below the CICR inside 4-1/2", 10.5# |

- production casing with no excess, 400' in the 4-1/2", 10.5# annulus assuming 7.88" bit size with 60% excess and 193' on top of the CICR to cover top perms. RD cementers.
18. Slowly pull out of the cement and TOO H to 3035'. Reverse circulate using biocide treated fresh water, to ensure tubing is clean. TOO H and SB 830' of 2-3/8" tbg. LD remaining tbg.
 19. MIRU WL. PU and RIH with two 3-1/8" perf guns with 3 spf, min 0.5" EHD, 120° phasing. Shoot 2' of squeeze holes at 1460' and 4' of squeeze holes at 800'. RDMO WL.
 20. PU and TIH with (4-1/2", 10.5#) CICR on 2-3/8" tbg. Set CICR at 830'.
 21. Establish circulation to surface with biocide treated fresh water, and pump 100 bbls to clean up hole.
 22. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water space. Pump Fox Hills Squeeze: 250 sxs (378cf) with 0.25 lb/sk polyflake, assuming 15.8 ppg & 1.51 cf/sk. Underdisplace by 5 bbls. Volume is based on 630' below the CICR inside 4-1/2", 10.5# production casing with no excess, 660' in the 4-1/2", 10.5# annulus assuming 7.88" bit size with 60% excess and 322' on top of the CICR to cover top perms. RD cementers.
 23. TOO H and SB 400' of 2-3/8" tbg. LD CICR, stinger, and remaining tbg.
 24. MIRU WL. RIH and jet cut 4-1/2", 10.5# casing at 200'. RDMO WL.
 25. Attempt to establish circulation and circulate 100 bbls with fresh water containing biocide to remove any gas.
 26. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
 27. Install BOP on casing head with 4-1/2", 10.5# pipe rams.
 28. TOO H and LD all 4-1/2", 10.5# casing. Remove 4-1/2", 10.5# pipe rams and install 2-3/8" pipe rams.
 29. TIH with mule shoe and 2-3/8" tubing to 1460'.
 30. Establish circulation with biocide treated fresh water and pump one hole volume 100 bbls.
 31. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Stub Plug: 40 sxs (60 cf) with 0.25 lb/sk Polyflake, assuming 15.8 ppg & 1.50 cf/sk. Volume is based on 200' in 4-1/2", 10.5# production casing with no excess, and 110' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 400'-100'. RDMO cementers. Notify engineering if circulation is ever lost during job.
 32. Slowly pull out of the cement and TOO H to 100'. Reverse circulate using biocide treated fresh water, to ensure the tubing is clean. TOO H, LD all 2-3/8" tbg.
 33. MIRU WL. Tag cement as needed. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
 34. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
 35. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
 36. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.

37. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
38. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
39. Welder cut casing minimum 5' below ground level.
40. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
41. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
42. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
43. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
44. Back fill hole with fill. Clean location, and level.
45. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.