

FORM  
6Rev  
12/05

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401155863

Date Received:

11/26/2016

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CHERYL LIGHT

Name of Operator: KERR MCGEE OIL &amp; GAS ONSHORE LP

Phone: (720) 929-6461

Address: P O BOX 173779

Fax: (720) 929-7461

City: DENVER State: CO Zip: 80217-

Email: CHERYL.LIGHT@ANADARKO.COM

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-19310-00

Well Name: HSR-PALMER

Well Number: 12-8

Location: QtrQtr: NWSW Section: 8 Township: 3N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.238560

Longitude: -104.920260

GPS Data:

Date of Measurement: 01/18/2006

PDOP Reading: 2.3

GPS Instrument Operator's Name: Chris Fisher

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 815

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7153	7162			
NIOBRARA	6889	6952			

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	714	500	714	0	VISU
1ST	7+7/8	4+1/2	11.6	7,278	150	7,278	6,060	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6810 with 25 sacks cmt on top. CIBP #2: Depth 80 with 25 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 6810 ft. to 6410 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 4200 ft. with 160 sacks. Leave at least 100 ft. in casing 3830 CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 90 sacks half in. half out surface casing from 915 ft. to 664 ft. Plug Tagged: ☒

Set 25 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CHERYL LIGHT

Title: SR REGULATORY ANALYST Date: 11/26/2016 Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: McCoy, Diane Date: 12/21/2016

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 6/20/2017

<b>COA Type</b>	<b>Description</b>
	<p>1) Prior to starting plugging operations a bradenhead test shall be performed. If the beginning pressure is greater than 25 psi, or if pressure remains at the conclusion of the test, or if any liquids were present contact COGCC Engineer for sampling requirements. The Form 17 shall be submitted within 10 days of the test.</p> <p>2) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.</p> <p>4) Indicated the well has a gyro from Dec. 2013 that has not been submitted to COGCC. Submit gyro survey data with Form 6 Subsequent Report of Abandonment.</p> <p>5) Note- production casing stub plug is also surface casing shoe plug. After pumping stub/shoe plug, shut down and wait on cement at minimum 4 hours; verify gas migration has been eliminated. If evidence of gas migration or pressure remains contact COGCC Engineer for an update to plugging orders. Plug must be tagged at 664' or shallower. Leave at least 100' cement in the wellbore for each plug.</p>

### **Attachment Check List**

<b>Att Doc Num</b>	<b>Name</b>
401155863	FORM 6 INTENT SUBMITTED
401155864	PROPOSED PLUGGING PROCEDURE
401155865	WELLBORE DIAGRAM

Total Attach: 3 Files

### **General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>
Engineer	Production records indicate this well has been SI since Jan. 2015. Operator needs to ensure that wells shut-in have a mechanical integrity test within two years of the initial shut-in date.	12/21/2016
Permit	Perfs on zones tab do not match completion report. Please submit updated 5A.	11/29/2016
Public Room	Document verification complete 11/28/16	11/28/2016

Total: 3 comment(s)