

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

12/13/2016

Submitted Date:

12/21/2016

Document Number:

682401612**FIELD INSPECTION FORM**

Loc ID 445237 Inspector Name: Binschus, Chris On-Site Inspection ☐ 2A Doc Num: _____

Operator Information:OGCC Operator Number: 100322Name of Operator: NOBLE ENERGY INCAddress: 1625 BROADWAY STE 2200City: DENVER State: CO Zip: 80202**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**5 Number of Comments2 Number of Corrective Actions☒ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
,		NBL_DJBU_Inspections@NB LENERGY.COM	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
445237	LOCATION	AC	03/29/2016		-	LC24-6 Tank	RI

General Comment:

[This is a stormwater inspection in response to Form 42- Notice of construction- Document #401138511.](#)

Location Construction

Location ID: 445237 CDP: _____

Comment: Topsoil has been stored along the entire perimeter of the location. Tackifier has been applied to the topsoil but areas (i.e., south, southeastern area) need additional tackifier because the application rate was too low, and wind erosion is starting to occur.

Corrective Action: Stabilize and protect topsoil per Rule 1002.b.

Date: 01/04/2017

Form 2A COAs:

Comment:

Corrective Action:

Date: _____

Wildlife BMPs:

Comment:

Corrective Action:

Date: _____

Comment:

Corrective Action:

Date: _____

On Site Inspection (305):

Surface Owner Contact Information:

Name: _____

Address: _____

Phone Number: _____

Cell Phone: _____

Operator Rep. Contact Information:

Landman Name: _____

Phone Number: _____

Date Onsite Request Received: _____

Date of Rule 306 Consultation: _____

Request LGD Attendance: _____

LGD Contact Information:

Name: _____ Phone Number: _____ Agreed to Attend: _____

Summary of Landowner Issues:

Summary of Operator Response to Landowner Issues:

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Tackifiers						Need additional tackifier on topsoil

Comment: [No stormwater BMPs in place prior to or during construction.](#)

Corrective Action: [Install sufficient BMPs in accordance with good engineering practices per Rule 1002.f. Refer to the 1002.f guidance document for further details.](#)

Date: 01/04/2017

Pits: ☐ NO SURFACE INDICATION OF PIT

COGCC Comments

Comment	User	Date
Refer to attached inspection photos in Document #682401628.	binschusc	12/21/2016

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
682401628	Location Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4034787