

Engineer: David Hasz
Cell Phone Number: 970-371-8820

BROWN 3-3A

PLUG and ABANDONMENT PROCEDURE

Step Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline . Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run in 09/19/11. RDMO Slickline .
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a min of 25 jts of 2-3/8" 4.7#, J-55, EUE tbg. Kill well as necessary using clean fresh water with biocide. ND WH. NU BOP. Unland tbg using unlanding joint and LD.
7. TOO H and SB 6840' 2-3/8" tbg. LD any remainder.
8. MIRU WL. PU and RIH with (4-1/2", 11.6#) gauge ring to 7550'. POOH.
9. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 7740' (collars at 7728' & 7770') to abandon the Dakota. POOH. RIH and dump 2 sx cement on CIBP. POOH.
10. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 7540' (collars at 7524' & 7568') to abandon the J Sand. POOH. RIH and dump 2 sx cement on CIBP. POOH.
11. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 6830' (collars at 6806' & 6848'). POOH. RDMO WL.
12. MIRU hydrotesters. TIH with 2-3/8" tbg to 6830' while hydrotesting to 3000 psi. RDMO hydrotesters.
13. Load hole with biocide treated fresh water and circulate all gas out of well. PT CIBP to 1000psi for 15 minutes.
14. MIRU Cementers. Pump Niobrara Balance Plug: Pump 25 sx (39 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 400' inside 4-1/2", 11.6# production casing with no excess. Cement will be from 6830'-6430'. RD cementers.
15. Slowly pull out of the cement and TOO H to 5930'. Reverse circulate using biocide treated fresh water, to ensure the tubing is clean. TOO H and SB 3750' of 2-3/8" tbg. LD remaining tbg.
16. MIRU WL. PU and RIH with two 3-1/8" perf guns with 3 spf, min 0.5" EHD, 120° phasing. Shoot 2' of squeeze holes at 4120' and 4' of squeeze holes at 3720'. RDMO WL.
17. PU and TIH with (4-1/2", 11.6#) CICR on 2-3/8" tbg. Set CICR at 3750'.
18. Establish circulation to surface with biocide treated fresh water, and pump 100 bbls to clean up hole.
19. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Sussex Squeeze: 155 sx (235 cf) with 0.25 lb/sk polyflake, assuming 15.8 ppg & 1.51 cf/sk. Underdisplace by 3 bbls. Volume is based on 370' below the CICR inside 4-1/2", 11.6# production casing with no excess, 400' in the 4-1/2", 11.6# annulus assuming 7.88" bit size with 60% excess and 190' on top of the CICR to cover top perfs. RD cementers.
20. Slowly pull out of the cement and TOO H to 3060'. Reverse circulate to ensure no cement is left in the tbg.
21. TOO H and SB 1370' of 2-3/8" tbg. LD stinger, and remaining tbg.
22. MIRU WL. RIH and jet cut 4-1/2", 11.6# casing at 1270'. RDMO WL.
23. Attempt to establish circulation and circulate (100 bbl) with fresh water containing biocide to remove any gas.
24. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
25. Install BOP on casing head with 4-1/2", 11.6# pipe rams.
26. TOO H and LD all 4-1/2", 11.6# casing. Remove 4-1/2", 11.6# pipe rams and install 2-3/8" pipe rams.
27. TIH with mule shoe and 2-3/8" tubing to 1370'.

28. Establish circulation with biocide treated fresh water and pump one hole volume (114 bbl).
29. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Stub Plug: 300 sx (450 cf) with 0.25 lb/sk Polyflake, assuming 15.8 ppg & 1.5 cf/sk. Volume is based on 100' in 4-1/2", 11.6# production casing with no excess, 542' in 7.88" bit size w/ 100% excess factor, and 203' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 1370'-525'. RDMO cementers. Notify engineering if circulation is ever lost during job.
30. Slowly pull out of the cement and TOO H to 100'. Reverse circulate using biocide treated fresh water, to ensure the tubing is clean. TOO H, LD all 2-3/8" tbg.
31. MIRU WL. Tag cement as needed. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
32. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
33. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
34. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
35. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
36. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
37. Welder cut casing minimum 5' below ground level.
38. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
39. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
40. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
41. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
42. Back fill hole with fill. Clean location, and level.
43. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.