

FORM
6Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



| | | | |
|----|----|----|----|
| DE | ET | OE | ES |
|----|----|----|----|

Document Number:

401182700

Date Received:

01/11/2017

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Kelsi Welch

Name of Operator: PDC ENERGY INC

Phone: (303) 831-3974

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: kelsi.welch@pdce.com

For "Intent" 24 hour notice required,

Name: Gomez, Jason

Tel: (970) 573-1277

COGCC contact:

Email: jason.gomez@state.co.us

API Number 05-123-19354-00

Well Name: SITZMAN

Well Number: 23-4

Location: QtrQtr: NESW Section: 4 Township: 5N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 56514

Field Name: KERSEY

Field Number: 44600

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.426530

Longitude: -104.557110

GPS Data:

Date of Measurement: 05/17/2008

PDOP Reading: 2.3

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 625

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

| Formation | Perf. Top | Perf. Btm | Abandoned Date | Method of Isolation | Plug Depth |
|-----------|-----------|-----------|----------------|---------------------|------------|
| CODELL | 6837 | 6847 | | | |

Total: 1 zone(s)

Casing History

| Casing Type | Size of Hole | Size of Casing | Weight Per Foot | Setting Depth | Sacks Cement | Cement Bot | Cement Top | Status |
|-------------|--------------|----------------|-----------------|---------------|--------------|------------|------------|--------|
| SURF | 12+1/4 | 8+5/8 | 24 | 392 | 275 | 392 | 0 | VISU |
| 1ST | 7+7/8 | 3+1/2 | 9.3 | 7,060 | 165 | 7,060 | 6,170 | CBL |
| S.C. 1.1 | | | | 4,286 | 160 | 4,286 | 3,300 | CBL |

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6787 with 2 sacks cmt on top. CIBP #2: Depth 6490 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 250 sks cmt from 675 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Sitzman 23-4 (05-123-19354)/Plugging Procedure (Intent)

Producing Formation: Codell 6837'-6847'

TD: 7060' PBDT: 7030'

Surface Casing: 8 5/8" 24# @ 392' w/ 275 sxs.

Production Casing: 3 1/2" 9.3# @ 7060' w/ 165 sks cmt. (TOC at 6170' CBL.)

160 sks were pumped ahead of a gel spacer (3300'-4286' CBL)

Tubing: 1.9" tubing set at 6813'. (2/6/2013)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 1.9" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6787'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with CIBP. Set BP at 6490'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with casing cutter. Cut 3 1/2" casing at 625'. Pull cut casing.
6. TIH with tubing to 675'. RU cementing company. Mix and pump 250 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kelsi Welch

Title: Production Tech Date: 1/11/2017 Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved, STEVE

COGCC Approved:

Date: 1/19/2017

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 7/18/2017

COA Type

Description

| | |
|--|---|
| | 1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) For the 675' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be at 342' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug. 3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete. 4) Prior to starting plugging operations a Bradenhead test shall be performed. If the beginning pressure is greater than 25 psi, or if pressure remains at the conclusion of the test, or if any liquids were present contact COGCC Engineering for sampling requirements. The Form 17 shall be submitted within 10 days of the test. |
|--|---|

Attachment Check List

Att Doc Num

Name

| | |
|-----------|-------------------------|
| 401182700 | FORM 6 INTENT SUBMITTED |
| 401182710 | WELLBORE DIAGRAM |
| 401182711 | WELLBORE DIAGRAM |

Total Attach: 3 Files

General Comments

User Group

Comment

Comment Date

| | | |
|-------------|---|------------|
| Public Room | Document verification complete 01/12/17 | 01/12/2017 |
|-------------|---|------------|

Total: 1 comment(s)