

FORM  
6Rev  
12/05

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401176831

Date Received:

01/04/2017

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Pesicka, Conor

Tel: (970) 415-0789

COGCC contact:

Email: conor.pesicka@state.co.us

API Number 05-123-23142-00

Well Name: WELLS RANCH

Well Number: 24-15

Location: QtrQtr: SESW Section: 15 Township: 6N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.481640

Longitude: -104.426170

GPS Data:

Date of Measurement: 10/13/2006

PDOP Reading: 2.6

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 2850

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6748	6756	09/13/2016	B PLUG CEMENT TOP	6698

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	539	300	539	0	VISU
1ST	7+7/8	4+1/2	10.5	6,925	470	6,925	2,914	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6400 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2900 ft. to 2650 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 280 sacks half in. half out surface casing from 750 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Wells Ranch 24-15 (05-123-23142)/Plugging Procedure (Intent)

Producing Formation: Codell 6748'-6756'

TD: 6949' PBDT: 6896'

Existing CIBP: Set at 6698' with 2 sxs cmt

Surface Casing: 8 5/8" 24# @ 539' w/ 300 sxs

Production Casing: 4 1/2" 10.5# and 11.6# @ 6925' w/470 sxs cmt (TOC at 2914' - CBL)

Tubing: 2 3/8" tubing set at 6604'. (9/13/2016)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set CIBP at 6400'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with casing cutter. Cut 4 1/2" casing at 2850'. Recovery cut 4 1/2" casing.
5. TIH with tubing to 2900'. Mix and pump 100 sxs of 15.8#/gal CI G cement down tubing.
6. Reset tubing to 750'. Mix and pump 280 sxs of 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen

Title: Reg Tech Date: 1/4/2017 Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved:

Date: 1/27/2017

**CONDITIONS OF APPROVAL, IF ANY:**

Expiration Date: 7/26/2017

**COA Type**

**Description**

	1)Submit Form 42 electronically to COGCC 48 hours prior to MIRU. 2)Properly abandon flowlines. Once flowlines are properly abandoned, file electronic form 42. 3)For 750' plug: pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours and tag plug – top of plug must be not deeper than 489' and provide minimum 10 sx plug at the surface. Leave at least 100' of cement in the wellbore for each plug.
--	--

**Attachment Check List**

**Att Doc Num**

**Name**

401176831	FORM 6 INTENT SUBMITTED
401177055	WELLBORE DIAGRAM
401177056	WELLBORE DIAGRAM

Total Attach: 3 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

Permit	Pass.	01/09/2017
Public Room	Document verification complete 01/04/17	01/04/2017
Permit	Returned to draft. Please re-attach wellbore diagrams, can't open.	01/03/2017

Total: 3 comment(s)