

Engineer: David Hasz  
Cell Phone Number: 970-371-8820

**UPRC 1-11L**

**PLUG and ABANDONMENT PROCEDURE**

**Step Description**

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline . Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run on 12/22/14. RDMO Slickline .
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a min of 25 jts of 1.90" 2.9#, tbg. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP. Unland tbg using unlanding joint and LD.
7. TOOH and SB 7200' 1.90" tbg. LD any remainder.
8. PU and TIH with (2-7/8", 6.5#) Bit and Scraper on 1.90" tbg to 7210'. TOOH, SB all 1.90" tbg. LD Bit and Scraper.
9. MIRU WL. PU and RIH with (2-7/8", 6.5#) CIBP and set at +/- 7200' (collars at 7172' & 7216'). POOH. RDMO WL.
10. MIRU Hydrotesters. TIH with 1.90" tbg to 7200' while hydrotesting to 3000 psi. RDMO Hydrotesters.
11. Load hole with biocide treated fresh water and circulate all gas out of well. PT CIBP to 2000psi for 15 minutes (2-7/8" csg to be used as a work string).
12. MIRU Cementers. Pump Niobrara Balance Plug: Pump 15 sx (23 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 555' inside 2-7/8", 6.5# production casing with no excess. Cement will be from 7200'-6645'. RD Cementers.
13. Slowly pull out of the cement and TOOH to 6145'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH and LD all 1.90" tbg.
14. MIRU WL. RIH and jet cut 2-7/8" 6.5# csg at 4395'. RDMO WL.
15. Attempt to establish circulation and circulate (400 bbl) with fresh water containing biocide to remove any gas and cleanup hole.
16. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
17. Install BOP on casing head with 2-7/8", 6.5# pipe rams. PU 2-7/8" csg to use as work-string.
18. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Sussex Plug: 155 sx (235 cf) with 0.25 lb/sk polyflake, assuming 15.8 ppg & 1.51 cf/sk. Volume is based on 405' in open hole assuming 7.88" bit size with 60% excess. RD Cementers.
19. Slowly pull out of the cement and TOOH to 3490'. Reverse circulate to ensure no cement is left in the work string.
20. TOOH to 935'. LD remaining csg.
21. Establish circulation with biocide treated fresh water.
22. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Stub Plug: 250 sx (375 cf) with 0.25 lb/sk Polyflake, assuming 15.8 ppg & 1.5 cf/sk. Volume is based on 439' in 7.88" bit size w/ 100% excess factor, and 201' in the 8-5/8", 23# surface casing with no excess. The plug is designed to cover 935'-295'. RDMO Cementers. Notify engineering if circulation is ever lost during job.
23. Slowly pull out of the cement and TOOH to 100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, LD all 2-7/8" tbg.
24. MIRU WL. Tag cement as needed. RIH 8-5/8", 23# CIBP to 80'. RDMO WL and WO rig.

- 25.** Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
- 26.** Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
- 27.** Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
- 28.** Capping crew will set and secure night cap on 8-5/8", 23# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
- 29.** Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
- 30.** Welder cut casing minimum 5' below ground level.
- 31.** Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
- 32.** Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
- 33.** Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
- 34.** Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
- 35.** Back fill hole with fill. Clean location, and level.
- 36.** Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.