

HALLIBURTON

iCem[®] Service

EXTRACTION OIL & GAS

United States of America

Date: Wednesday, November 09, 2016

Hester Farms B-36HC

Surface

Job Date: Monday, November 07, 2016

Sincerely,

Lauren Roberts

Legal Notice

Disclaimer:

All information in this report is provided subject to the terms and conditions which govern the services provided by Halliburton. Halliburton personnel use their best efforts in gathering information and their best judgment in interpreting it, but any interpretation, research, analysis or recommendation furnished by Halliburton are opinions based upon inferences from measurements and empirical relationships and assumptions, which inferences and empirical relationships and assumptions are not infallible, and with respect to which professionals in the industry may differ. Accordingly, HALLIBURTON IS UNABLE TO GUARANTEE THE ACCURACY OF ANY CHART INTERPRETATION, RESEARCH ANALYSIS, OR JOB RECOMMENDATION and any interpretation or recommendation is not for use of or reliance upon by any third party. The customer has full responsibility for any of its decisions which are based on the information provided in this report.

Table of Contents

1.0	Cementing Job Summary	4
1.1	Executive Summary	4
2.0	Real-Time Job Summary	7
2.1	Job Event Log	7
3.0	Attachments.....	8
3.1	903648708 Extraction Hester Farms B-36HC Surface-Custom Results (1).png	8
3.2	903648708 Extraction Hester Farms B-36HC Surface-Custom Results.png.....	9

1.0 Cementing Job Summary

1.1 Executive Summary

Halliburton appreciates the opportunity to perform the cementing services on the **Hester Farms B-36HC cement Surface** casing job. A pre-job safety meeting was held before the job where details of the job were discussed, potential safety hazards were reviewed, and environmental compliance procedures were outlined.

30 bbl. of cement returned to surface.

Halliburton maintains a continuous quality improvement process and appreciates any comments or suggestions that you may have. Halliburton again thanks you for the opportunity to perform service work on this well. We hope to be your solutions provider for future projects.

Respectfully,

Halliburton [Ft. Lupton]

The Road to Excellence Starts with Safety

Sold To #: 369404	Ship To #: 3684137	Quote #:	Sales Order #: 0903648708
Customer: EXTRACTION OIL & GAS -		Customer Rep: Larry Siegel	
Well Name: HESTER FARMS		Well #: B-36HC	API/UWI #: 05-123-41998-00
Field: WATTENBERG	City (SAP): EATON	County/Parish: WELD	State: COLORADO
Legal Description: 31-7N-66W-1604FNL-202FWL			
Contractor:		Rig/Platform Name/Num: Spud Rig	
Job BOM: 7521			
Well Type: HORIZONTAL OIL			
Sales Person: HALAMERICA\HX38199		Srvc Supervisor: Nathaniel Moore	

Job

Job depth MD	1588ft	Job Depth TVD	
--------------	--------	---------------	--

Well Data

Description	New / Used	Size in	ID in	Weight lbm/ft	Thread	Grade	Top MD ft	Bottom MD ft	Top TVD ft	Bottom TVD ft
Casing		9.625	8.921	36			0	1588	0	1588
Open Hole Section			13.5				0	1588	0	1588

Tools and Accessories

Type	Size in	Qty	Make	Depth ft	Type	Size in	Qty	Make
Float Shoe	9.625			1588	Bottom Plug	9.625		HES

Fluid Data

Stage/Plug #: 1

Fluid #	Stage Type	Fluid Name	Qty	Qty UoM	Mixing Density lbm/gal	Yield ft3/sack	Mix Fluid Gal	Rate bbl/min	Total Mix Fluid Gal
1	Fresh Water	Fresh Water	0	bbl	8.33				

Fluid #	Stage Type	Fluid Name	Qty	Qty UoM	Mixing Density lbm/gal	Yield ft3/sack	Mix Fluid Gal	Rate bbl/min	Total Mix Fluid Gal
2	SwiftCem	SWIFTCEM (TM) SYSTEM		sack	13.5	1.74		5	9.2
9.20 Gal		FRESH WATER							

Fluid #	Stage Type	Fluid Name	Qty	Qty UoM	Mixing Density lbm/gal	Yield ft3/sack	Mix Fluid Gal	Rate bbl/min	Total Mix Fluid Gal
3	Fresh Water	Fresh Water	0	bbl	8.33				

Cement Left In Pipe	Amount		Reason	Shoe Joint
	42 ft			

30 bbl cement to surface


2.0 Real-Time Job Summary

2.1 Job Event Log

Type	Seq. No.	Activity	Graph Label	Date	Time	Source	Comments
Event	1	Call Out	Call Out	11/7/2016	13:30:00	USER	OL time 1830. Verify equipment and materials
Event	2	Depart Yard Safety Meeting	Depart Yard Safety Meeting	11/7/2016	16:30:00	USER	
Event	3	Assessment Of Location Safety Meeting	Assessment Of Location Safety Meeting	11/8/2016	17:30:00	USER	Spot equipment and rig up. Rig running casing
Event	4	Other	Meet with customer rep	11/8/2016	18:13:33	USER	TD 1588' 13.5 " open hole. TP 1550'. SJ 42' 9.625" 36# J-55
Event	5	Start Job	Start Job	11/8/2016	21:16:59	COM1	Fill lines 3 bbl water. Circulation established
Event	6	Test Lines	Test Lines	11/8/2016	21:19:06	COM1	3000 psi pressure test with 500 psi kick-out test
Event	7	Pump Spacer 1	Pump Spacer 1	11/8/2016	21:22:44	COM1	20 bbl water with dye in last 10
Event	8	Pump Lead Cement	Pump Lead Cement	11/8/2016	21:40:48	COM1	525 sks/163 bbl 1.74 ft3/sk 9.2 gal/sk
Event	9	Drop Top Plug	Drop Top Plug	11/8/2016	22:09:34	COM1	Wash-up on top of plug
Event	10	Pump Displacement	Pump Displacement	11/8/2016	22:09:38	COM1	117 bbl water displacement
Event	11	Other	Cement to surface	11/8/2016	22:20:00	USER	30 bbl cement back
Event	12	Bump Plug	Bump Plug	11/8/2016	22:27:00	COM1	490 psi final pump pressure. Pressured up to 1500 psi for casing test
Event	13	Other	check floats	11/8/2016	22:28:14	COM1	0.5 bbl back
Event	14	End Job	End Job	11/8/2016	22:31:56	COM1	
Event	15	Pre-Rig Down Safety Meeting	Pre-Rig Down Safety Meeting	11/8/2016	22:31:57	USER	
Event	16	Depart Location Safety Meeting	Depart Location Safety Meeting	11/8/2016	23:00:00	USER	

3.0 Attachments

3.1 903648708 Extraction Hester Farms B-36HC Surface-Custom Results (1).png

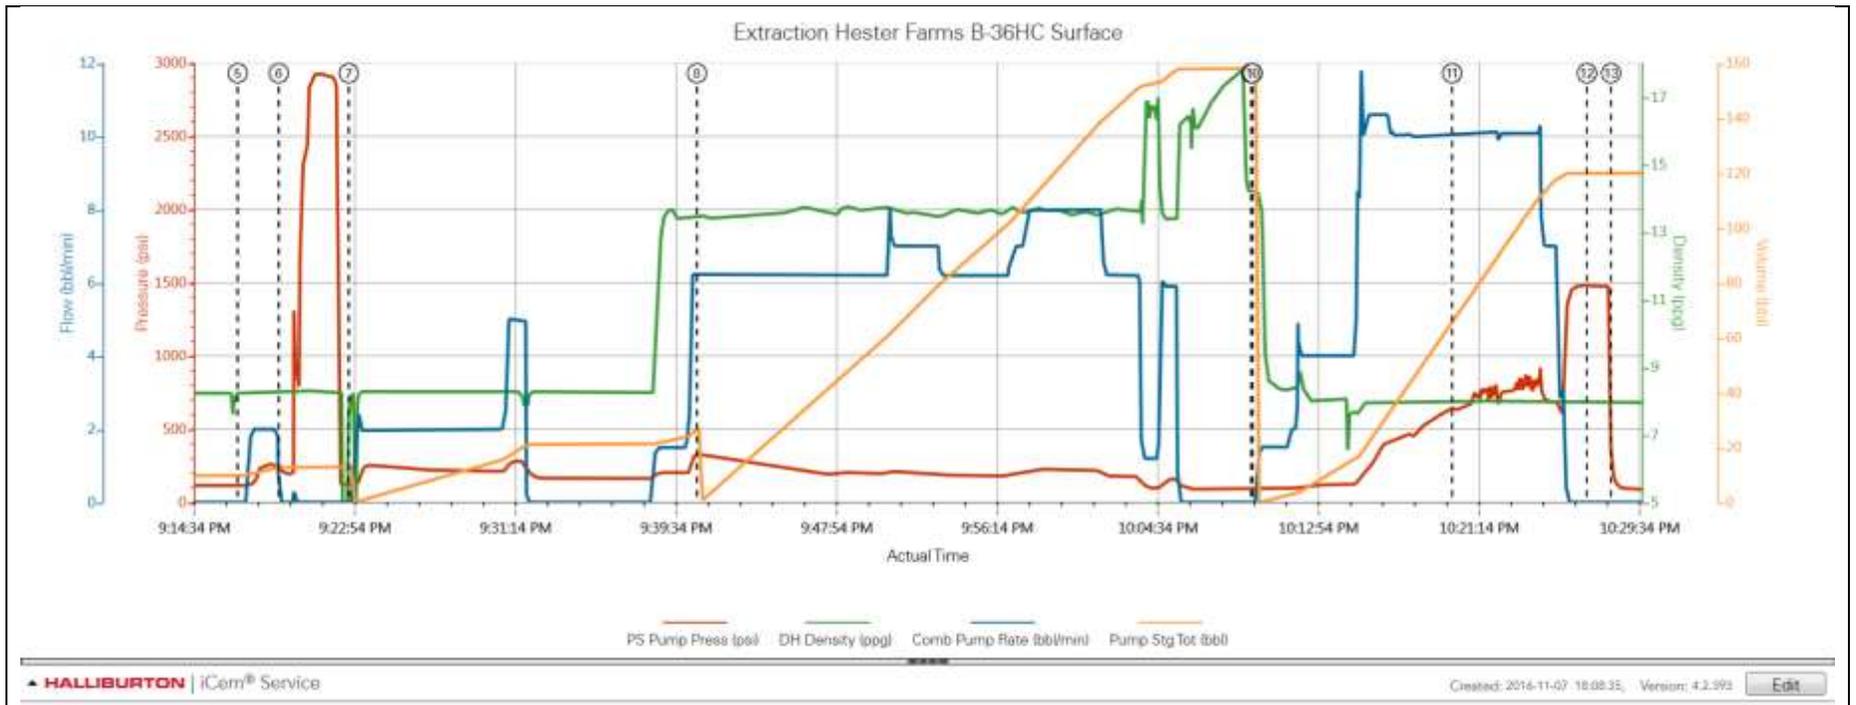

3.2 903648708 Extraction Hester Farms B-36HC Surface-Custom Results.png

