

FORM
6Rev
12/05

State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401206846

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Kelsi Welch

Name of Operator: PDC ENERGY INC

Phone: (303) 831-3974

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: kelsi.welch@pdce.com

For "Intent" 24 hour notice required,

Name:

Tel:

COGCC contact:

Email:

API Number 05-123-14089-00

Well Name: STATE LEASE 81

Well Number: 42-16

Location: QtrQtr: SENE Section: 16 Township: 6N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 67844

Field Name: WATTENBERG

Field Number: 90750

☐ Notice of Intent to Abandon☒ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.487810

Longitude: -104.547530

GPS Data:

Date of Measurement: 12/07/2008

PDOP Reading: 1.7

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment: ☐ Dry☐ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☐ No

Estimated Depth:

Fish in Hole: ☐ Yes☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☐ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7028	7041	01/09/2017	B PLUG CEMENT TOP	6687
FORT HAYS	7006	7024	01/09/2017	B PLUG CEMENT TOP	6687
NIOBRARA	6737	6952	01/09/2017	B PLUG CEMENT TOP	6687

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	301	175	301	0	
1ST	7+7/8	4+1/2	11.6	7,170	220	7,170	6,150	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6687 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 667 sks cmt from 1064 ft. to 30 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: 977 ft. of 4+1/2 inch casing

Plugging Date: 01/11/2017

*Wireline Contractor: Ranger

*Cementing Contractor: Bayou

Type of Cement and Additives Used: 15.8#/gal CI G cement

Flowline/Pipeline has been abandoned per Rule 1103 ☒ Yes ☐ No

*ATTACH JOB SUMMARY

Technical Detail/Comments:

State Lease 81 42-16 (05-123-14089)/Plugging Procedure (Subsequent)
Producing Formation: Codell 7028'-7041' Fort Hayes 7006'-7024' Niobrara 6737'-6952'
TD: 7170' PBTD: 7082'
Surface Casing: 8 5/8" 24# @ 301' w/ 175 sxs
Production Casing: 4 1/2" 11.6# @ 7170' w/220 sks cmt (TOC 6150' – Estimated)

Tubing: 2 3/8" tubing set at 7019'. (2/4/2016)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 2 3/8" tubing.
2. TIH with CIBP. Set CIBP at 6687'. Top with 2 sxs 15.8#/gal CI G cement.
3. Run CBL from CIBP to top of cement. CBL confirmed Niobrara formation has cement coverage to 6132'.
4. TIH with casing cutter. Cut 4 1/2" casing at 977'. Pull cut casing.
5. TIH with tubing to 1064'. Mix and pump 667 sxs of 15.8#/gal CI G cement down tubing to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Kelsi Welch

Title: Production Tech

Date: _____

Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY:

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

401206850	WIRELINER JOB SUMMARY
401206851	CEMENT JOB SUMMARY
401206853	WELLBORE DIAGRAM
401206941	CEMENT BOND LOG

Total Attach: 4 Files

General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	------------------------

Total: 0 comment(s)