



SRC ENERGY

**Operator:** SRC Energy  
**Well Name:** Ogilvie 24-4  
**Legal:** NWNW Section 24, Township 5N, Range 64W  
**Location:** Weld County, CO  
**API:** 05-123-13696  
**Surface:** 9.625" 36# @ 339'                      **Hole Size:** 13.75"                      **TOC:** Surface  
**Production:** 4.5" 11.6# @ 6832'                      **Hole Size:** 7.875"                      **TOC:** 5590' (CBL)  
**Perforations:** 6372' – 6466' (Niobrara), 6643' – 6657' (Codell)  
**TD:** 6833'

### P&A Procedure

1. Conduct pre-job safety meeting and complete daily JSA
2. Blow down well if necessary, circulate hole with treated water
3. Dig out around wellhead and check surface annulus for pressure
4. MIRU WO unit, ND wellhead, NU BOP, tally all pipe
5. TIH w/ 4-1/2", 11.6# retainer, set at 6,279' and squeeze perfs (50 sxs)
  - a. Release off of retainer and pump 5 sx on top to create 50' plug
  - b. TOOH
6. Pressure test csg to 500 psi for 15 minutes
7. Cut 4.5" @ 349'
8. TIH to 399' and pump a 399' shoe plug (0' – 399')
  - a. 190 sx of 15.8# class G neat 1.15 cu./ft. yield cement, (399' – 0')
  - b. 50' out of surface casing
  - c. Wait 4 hours and tag plug
9. RDMO WO unit
10. Dig up wellhead and cut off 10' below restored ground level, top off if necessary
11. Weld on cap with ID plate, inscribed with well location, and identity
12. Backfill, clean location
13. P&A complete