

**FORM
INSP**

Rev
X/15

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

03/27/2017

Submitted Date:

03/27/2017

Document Number:

682401919

FIELD INSPECTION FORM

Loc ID 442484 Inspector Name: Binschus, Chris On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 26580
 Name of Operator: BURLINGTON RESOURCES OIL & GAS LP
 Address: PO BOX 4289
 City: FARMINGTON State: NM Zip: 87499

Findings:

- 8 Number of Comments
- 0 Number of Corrective Actions
- Corrective Action Response Requested

Contact Information:

Contact Name	Phone	Email	Comment
Prasanna, Sonu		Sonu.Prasanna@conocophillips.com	All Inspections
Farrell, Larissa		Larissa.L.Farrell@conocophillips.com	All Inspections
Bailey, Keith		Keith.S.Bailey@ConocoPhillips.com	All Inspections w/ CAs

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
442485	WELL	XX	07/15/2015	LO	005-07242	Montezuma 4-64 18-13 4H	CI

General Comment:

This is a construction and stormwater inspection in response to Form 42- Notice of construction- Document #401235487. This is a short corrective action because the Operator failed to install stormwater BMPs prior to, or at the beginning of, construction activities.

Location Construction

Location ID: 442484 CDP: _____

Comment: Topsoil salvaged and stored along the eastern perimeter of location. Per Rule 1002, topsoil shall be stabilized and protected from degradation due to wind and water erosion. Per Rule 1002, BMPs to prevent weed establishment and to maintain soil microbial activity shall be implemented.

Corrective Action: **Date:** _____

Form 2A COAs:

Comment: An area of 5.03 acres was mapped on 3/27/2017 using a Trimble Juno 3B handheld device.

Corrective Action: **Date:** _____

Wildlife BMPs:

Comment:

Corrective Action: **Date:** _____

Comment: No stormwater BMPs were observed during the inspection. COGCC staff communicated with an operator representative at location that stormwater BMPs were required prior to, or at the start of, construction. COGCC staff also called and left a voice message with another operator representative.

Corrective Action: Install required BMPs per Rule 1002.f. **Date:** 03/29/2017

On Site Inspection (305):

Surface Owner Contact Information:

Name: _____ Address: _____

Phone Number: _____ Cell Phone: _____

Operator Rep. Contact Information:

Landman Name: _____ Phone Number: _____

Date Onsite Request Received: _____ Date of Rule 306 Consultation: _____

Request LGD Attendance: _____

LGD Contact Information:

Name: _____ Phone Number: _____ Agreed to Attend: _____

Summary of Landowner Issues:

Summary of Operator Response to Landowner Issues:

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

Inspected FacilitiesFacility ID: 442485 Type: WELL API Number: 005-07242 Status: XX Insp. Status: CI**COGCC Comments**

Comment	User	Date
Refer to attached inspection photos in Document #682401921.	binschusc	03/27/2017

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
401245389	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4110431
682401921	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4110300