

FORM
6Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401261716

Date Received:

04/18/2017

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Jon Lefor

Name of Operator: NOBLE ENERGY INC

Phone: (970) 573-1535

Address: 1625 BROADWAY STE 2200

Fax:

City: DENVER State: CO Zip: 80202

Email: jon.lefor@nblenergy.com

For "Intent" 24 hour notice required,

Name: Gomez, Jason

Tel: (970) 573-1277

COGCC contact:

Email: jason.gomez@state.co.us

API Number 05-123-13828-00

Well Name: PLUMB

Well Number: B5-11

Location: QtrQtr: NESW Section: 5 Township: 5N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 56484

Field Name: KERSEY

Field Number: 44600

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.426040

Longitude: -104.576440

GPS Data:

Date of Measurement: 03/05/2007

PDOP Reading: 1.5

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 519

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6854	6868			
NIOBRARA	6545	6768			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	319	175	319	0	VISU
1ST	7+7/8	4+1/2	15.10	7,029	220	7,029	5,770	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6495 with 2 sacks cmt on top. CIPB #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 240 sacks. Leave at least 100 ft. in casing 2400 CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 205 sacks half in. half out surface casing from 569 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Diane Blair

Title: Engineering Technician Date: 4/18/2017 Email: diane.blair@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 4/28/2017

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 10/27/2017

<u>COA Type</u>	<u>Description</u>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) For the 569' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be at 269' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug.</p> <p>3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.</p> <p>4) Prior to starting plugging operations a Bradenhead test shall be performed. If the beginning pressure is greater than 25 psi, or if pressure remains at the conclusion of the test, or if any liquids were present contact COGCC Engineering for sampling requirements. The Form 17 shall be submitted within 10 days of the test.</p>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401261716	FORM 6 INTENT SUBMITTED
401261719	WELLBORE DIAGRAM
401261720	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Public Room	Document verification complete 04/25/17	04/25/2017
Permit	Passes permitting.	04/25/2017

Total: 2 comment(s)