

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401332384

Date Received:

07/05/2017

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Gomez, Jason

Tel: (970) 573-1277

COGCC contact:

Email: jason.gomez@state.co.us

API Number 05-123-11133-00

Well Name: MELLON

Well Number: 28-1

Location: QtrQtr: NESW Section: 28 Township: 5N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.368780

Longitude: -104.899560

GPS Data:

Date of Measurement: 10/08/2010

PDOP Reading: 1.7

GPS Instrument Operator's Name: Steve Cure

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 563

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7047	7064			
NIOBRARA	6714	6854			

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	363	350	363	0	VISU
1ST	7+7/8	4+1/2	11.6	7,150	225	7,150	6,400	CALC

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6664 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 185 sks cmt from 613 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 4546 ft. with 150 sacks. Leave at least 100 ft. in casing 4831 CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Mellon 28-1 (05-123-11133)/Plugging Procedure (Intent)  
Producing Formation (Perforations): Niobrara: 6714'-6854' Codell: 7047'-7064'  
TD: 7180' PBDT: 7118'  
Surface Casing: 8 5/8" 24# @ 363' w/ 350 sxs  
Production Casing: 4 1/2" 11.6# @ 7150' w/ 225 sxs cmt (TOC @ 6400' - CBL).

Tubing: 2 3/8" tubing set @ 7030' (11/18/2010).

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6664'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with perforation gun. Shoot 2 holes for annular squeeze at 4846' @ 1 SPF or preferred.
5. Set CICR at 4831'. Sting in and pump 130 sxs 15.8#/gal CI G cement. Displace tubing leaving 10 sxs cement in tubing. Sting out and leave 10 sxs on top of CICR.
6. TIH with casing cutter. Cut 4 1/2" casing at 563'. Pull cut casing.
7. TIH with tubing to 613'. Mix and pump 185 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen

Title: Reg TEch Date: 7/5/2017 Email: JEnifer.Hakkarinen@pdce.com

Based on the information provided, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved:

Date: 7/18/2017

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 1/17/2018

COA Type	Description
	1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) For the 613' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be at 313' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug. 3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.
	1) Prior to starting plugging operations a Bradenhead test shall be performed. If the beginning pressure is greater than 25 psi, or if pressure remains at the conclusion of the test, or if any liquids were present contact COGCC Engineering for sampling requirements. The Form 17 shall be submitted within 10 days of the test.

### Attachment Check List

Att Doc Num	Name
401332384	FORM 6 INTENT SUBMITTED
401332462	WELLBORE DIAGRAM
401332463	WELLBORE DIAGRAM
401332466	GYRO SURVEY

Total Attach: 4 Files

### General Comments

User Group	Comment	Comment Date
Public Room	Document verification complete 07/11/17	07/11/2017

Total: 1 comment(s)