

**FORM
INSP**

Rev
X/15

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

07/10/2017

Submitted Date:

07/12/2017

Document Number:

690100003

FIELD INSPECTION FORM

Loc ID _____ Inspector Name: Maclaren, Joe On-Site Inspection
2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 47121
Name of Operator: KERR MCGEE GATHERING LLC
Address: PO BOX 173779
City: DENVER State: CO Zip: 80217

Findings:

- 4 Number of Comments
- 0 Number of Corrective Actions
- Corrective Action Response Requested

Contact Information:

Contact Name	Phone	Email	Comment
Gintautas, Peter		peter.gintautas@state.co.us	
Schlagenhauf, Mark		mark.schlagenhauf@state.co.us	
,		cogccinspections@anadarko.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
451308	SPILL OR RELEASE	AC	07/11/2017		-	SPILL/RELEASE POINT	EG

General Comment:

Engineering Integrity Inspection performed on July 10th, 2017 in response to initial form 19 spill report Doc #401329524 received by COGCC on 06/30/2017 that outlines: On June 30, 2017, a release of at least 1 barrel of condensate occurred at the 16-80-40-4" Gathering Line when the line was struck during excavation activities. Emergency response personnel were notified and responded to the location. The affected line was isolated and controlled. Details of observations made during this field inspection are available in the comment section of this report. Photo's uploaded and can be accessed via link(s) at the end of this report.

Inspected FacilitiesFacility ID: 451308 Type: SPILL OR API Number: - Status: AC Insp. Status: EG**COGCC Comments**

Comment	User	Date
Note: Please document the details of root cause of failure evaluation, measures taken to prevent the problem from reoccurring and description of pipeline repairs completed on the COGCC supplemental form 19.	maclarej	07/12/2017
Note: The excavation work taking place at the time of the 4" line strike was being completed as part of the remediation work in progress for the following (COGCC spill ID #451119): COGCC supplemental form 19 spill report Doc #401314728 submitted on 06/23/2017 that states on June 14, 2017, greater than 100 barrels of condensate were released outside of containment from the 13-897-8" Condensate Line. Pipe blowdown, fluid recovery, and soil excavation activities are ongoing. The condensate line was isolated and an emergency pit was dug to allow the line to depressurize into a controlled area.	maclarej	07/12/2017
COGCC Inspector met with Kerr McGee contract personnel with Platte River inspection services while on location. The 4" line strike was caused by an excavator using a sheeps foot roller to compact soil as part of an ongoing remediation project. The 4" gathering line is located in a major pipeline/ utility ROW that runs N-S and crosses county road 18 in Weld County. Based on discussions on site at the time of this inspection, Utility (811) locates were called in but this line was not identified or marked; As a result, the buried 4" gathering line was struck during excavation activities and resulted in a release.	maclarej	07/12/2017

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
401339249	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4195743
690100012	View looking South at pipeline remediation site	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4195740
690100013	4" gathering line strike/ from compaction equipment	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4195741
690100014	View to east; exposed pipelines in remediation area	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4195742