

# Husky Oil, Inc

## Husky Et Al State #2-16

### Remediation Program

**Objective** - abandon well to COGCC standard

#### **Program of Operations**

- 1 Excavate around wellbore
- 2 Clean and weld on stub to the 8-5/8" Casing
- 3 Install bowl and BOPs
- 4 Drill out cement and wash down with stiff BHA to 8210' and tag plug
- 5 Spot plug from 7826-7200' with class G cement (160 sx) and tag once set
- 6 Spot plug from 50' below the base of the Fox Hills (75 sx) with class G cement and tag plug once set
- 7 Spot plug from 50' below the base of the Arapahoe (50 sx) with class G cement (no tag).
- 8 Set 20 sx surface plug. Cut off 4' below surface and cap with plate showing well details including:

**Well Name:** Husky Et Al State #2-16

**API Number:** 05-005-06685

**Section Township Range:** 16-5-64

**Footages:** 660' FNL - 660' FWL