

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401367123

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: AJ PAINE

Name of Operator: NOBLE ENERGY INC

Phone: (720) 587-2374

Address: 1625 BROADWAY STE 2200

Fax:

City: DENVER State: CO Zip: 80202

Email: AJ.PAINE@NBLENERGY.COM

For "Intent" 24 hour notice required,

Name: Montoya, John

Tel: (970) 397-4124

COGCC contact:

Email: john.montoya@state.co.us

API Number 05-123-15915-00

Well Name: SPIKE ST GWS

Well Number: D 16-14

Location: QtrQtr: SESW Section: 16 Township: 3N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 70/7884-S

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.219420

Longitude: -104.558340

GPS Data:

Date of Measurement: 09/14/2006

PDOP Reading: 2.9

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☒ No

Estimated Depth:

Fish in Hole: ☒ Yes☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details: BIT AND SCRAPER STUCK AT 6924-6973. TRIED TO FISH AT GYRO, NOT SUCCESSFUL

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6966	6976			
SUSSEX	4330	4370	07/14/2005	SQUEEZED	4370

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	351	260	351	0	VISU
1ST	7+7/8	3+1/2	9.2	7,091	190	7,091	6,364	CBL
S.C. 1.1				4,370	150	4,370	4,330	CALC
S.C. 1.2				4,650	260	4,650	4,208	CBL
S.C. 1.3				508	50	508	0	CBL

### Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6916 with 5 sacks cmt on top. CIPB #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 20 sks cmt from 4650 ft. to 4200 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 2400 ft. with 180 sacks. Leave at least 100 ft. in casing 2300 CICR Depth  
Perforate and squeeze at 730 ft. with 80 sacks. Leave at least 100 ft. in casing 630 CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 30 sacks half in. half out surface casing from 630 ft. to 0 ft. Plug Tagged: ☒  
Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
Type of Cement and Additives Used: \_\_\_\_\_  
Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: ANGELA FIORE  
Title: ENGINEERING TECHNICIAN Date: \_\_\_\_\_ Email: ANGELA.FIORE@NBLENERGY.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: \_\_\_\_\_

COA Type

Description

### Attachment Check List

Att Doc Num

Name

401367226	WELLBORE DIAGRAM
-----------	------------------

401367227	WELLBORE DIAGRAM
-----------	------------------

Total Attach: 2 Files

### General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)