

## Plugging Procedure

Blue Chip Oil Inc. - Jervis #21-14 - NENW 14-T2N-R64W 6PM - Weld County, CO

API 05-123-22980

KB: 5159' GL: 5148'

8 5/8" 24# csg 1087'

4 1/2" 13.5# csg @ 7638'

Base Fox Hills: 887'

NB-CD Perforations: 6820' – 7057''

1. Blow down well, circulate hole with water to remove oil and kill.
2. RU BOP.
3. Pull and stand back tubing, tally tubing.
4. TIH with tubing and CIBP.
5. Set CIBP at approximately 6790'.
6. RU cementers, place 25 sxs balanced plug on top CIBP.
7. TOH and lay down tubing.
8. Fill hole with water.
9. Perforate @ 1140'' KB, establish circulation.
10. Cement down 4 1/2" csg through perforations until cement reaches surface in annulus (approximately 285 sxs).
11. RD cementers, clean hoses & equipment.
12. Flush flow line with water.
13. Top off cement in 4 1/2" casing and annulus if necessary.
14. Rig down, move out rig.
15. Cut off casing strings at 4', weld on cap with weep hole.
16. Clean up location.