

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401304463

Date Received:

06/09/2017

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

**For "Intent" 24 hour notice required,**

Name: Montoya, John

Tel: (970) 397-4124

**COGCC contact:**

Email: john.montoya@state.co.us

API Number 05-123-26302-00

Well Name: GUTTERSEN

Well Number: 44-8

Location: QtrQtr: SESE Section: 8 Township: 3N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.234670

Longitude: -104.454470

GPS Data:

Date of Measurement: 01/18/2008

PDOP Reading: 5.2

GPS Instrument Operator's Name: HOLLY L. TRACY

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☒ No

Estimated Depth:

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6870	6876			
NIOBRARA	6658	6664			

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	751	530	751	0	VISU
1ST	7+7/8	4+1/2	10.5	6,986	140	6,986	0	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6608 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 80 sks cmt from 951 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

#### Technical Detail/Comments:

Guttersen 44-8 (05-123-26302)/Plugging Procedure (Intent)  
Producing Formation (Perforations): Niobrara: 6658'-6664' Codell: 6870'-6876'  
TD: 7022' PBT: 6972'  
Surface Casing: 8 5/8" 24# @ 751' w/ 530 sxs  
Production Casing: 4 1/2" 10.5# @ 6986' w/ 610 sxs cmt (TOC @ Surface - CBL). Lite lead cement used therefore CBL not able to show full coverage.

Tubing: 2 3/8" tubing set @ 6855' (4/17/2008).

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6608'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with tubing to 951'. RU cementing company. Mix and pump 80 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
5. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen  
Title: Reg Tech Date: 6/9/2017 Email: JEnifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: BURN, DIANA Date: 8/13/2017

**CONDITIONS OF APPROVAL, IF ANY:**

Expiration Date: 2/12/2018

**COA Type****Description**

	1) Prior to starting plugging operations a bradenhead test shall be performed. If the beginning pressure is greater than 25 psi, or if pressure remains at the conclusion of the test, or if any liquids were present contact COGCC Engineer for sampling requirements. The Form 17 shall be submitted within 10 days of the test. 2) Provide 48 hour notice of plugging MIRU via electronic Form 42. 3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete.
--	--

**Attachment Check List****Att Doc Num****Name**

401304463	FORM 6 INTENT SUBMITTED
401304472	WELLBORE DIAGRAM
401304473	WELLBORE DIAGRAM

Total Attach: 3 Files

**General Comments****User Group****Comment****Comment Date**

Engineer	Requested cement report for the production string.	07/27/2017
Engineer	On hold- Emailed operator, different TOC.	06/26/2017
Public Room	Document verification complete 06/09/17	06/09/2017

Total: 3 comment(s)