

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:
401367191
Date Received:
08/08/2017

FIR RESOLUTION FORM

CA Summary:
1 of 1 CAs from the FIR responded to on this Form
1 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 97730
Name of Operator: WYMAN* LOUIS M DBA WYMAN INC
Address: P O BOX 278
City: CRAIG State: CO Zip: 81626
Contact Name and Telephone:
Name:
Phone: () Fax: ()
Email:

Additional Operator Contact:

Contact Name: Wyman, David
Phone: 970-701-9388
Email: brokenbox6431@yahoo.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 689800034
Inspection Date: 07/13/2017 FIR Submit Date: 07/13/2017 FIR Status:

Inspected Operator Information:

Company Name: WYMAN* LOUIS M DBA WYMAN INC Company Number: 97730
Address: P O BOX 278
City: CRAIG State: CO Zip: 81626

LOCATION - Location ID: 316761

Location Name: ROBSON-WYMAN-64N89W Number: 16SWSW County: ROUTT
Qtrqr: SWS Sec: 16 Twp: 4N Range: 89W Meridian: 6
W
Latitude: 40.310120 Longitude: -107.401150

FACILITY - API Number: 05-107-00 Facility ID: 232681

Facility Name: ROBSON-WYMAN Number: 14-16
Qtrqr: SWS Sec: 16 Twp: 4N Range: 89W Meridian: 6
W
Latitude: 40.310120 Longitude: -107.401150

CORRECTIVE ACTIIONS:

1 CA# 85971

Corrective Action: Securely fasten all valves, pipes, and fittings to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 605.d. Control and contain spills/releases and clean up per Rule 906.a. Contact COGCC EPS staff.

Date: 08/14/2017

Response: CA COMPLETED Date of Completion: 08/08/2017

The oil stained soil was cleaned up (1 - 5 gallon bucket of soil). This stain was of an unknown origin. This tank is not connected to the well or any other tank. I suspect it was a spilled bucket on the surface. All valves on this

Operator Comment: tank are in good working order.

A flow line pressure test was conducted on the 2" sch. 40 flow line (water line) next to the other water stained area noticed by the inspector. This test was a fail. On 8/8/2017 a 2" section of the flow line was found to be cracked, this was replaced. On this same day, after replacing the defective pipe I conducted a 2nd flow line pressure test @ 35 psi. This test was a pass. The faulty section of pipe has been remedied.

COGCC Decision: Approved pending re-inspection

COGCC Representative: Approved pending re-inspection.

OPERATOR COMMENT AND SUBMITTAL

Comment:

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: David Wyman

Signed: _____

Title: Manager

Date: 8/8/2017 3:37:32 PM

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

Document Number **Description**

401367191	FIR RESOLUTION SUBMITTED
-----------	--------------------------

Total Attach: 1 Files