

FORM
6Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401374892

Date Received:

08/14/2017

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: MONICA PATEL

Name of Operator: NOBLE ENERGY INC

Phone: (610) 750-4586

Address: 1625 BROADWAY STE 2200

Fax:

City: DENVER State: CO Zip: 80202

Email: mpatel@srcenergy.com

For "Intent" 24 hour notice required,

Name: Gomez, Jason

Tel: (970) 573-1277

COGCC contact:

Email: jason.gomez@state.co.us

API Number 05-123-13070-00

Well Name: ALLES

Well Number: 1-23

Location: QtrQtr: NENW Section: 23 Township: 6N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 55541

Field Name: BRACEWELL

Field Number: 7487

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.479300

Longitude: -104.747350

GPS Data:

Date of Measurement: 08/31/2006

PDOP Reading: 5.1

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 805

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

| Formation | Perf. Top | Perf. Btm | Abandoned Date | Method of Isolation | Plug Depth |
|-----------|-----------|-----------|----------------|---------------------|------------|
| CODELL | 7180 | 7190 | | | |
| NIOBRARA | 7003 | 7018 | | | |

Total: 2 zone(s)

Casing History

| Casing Type | Size of Hole | Size of Casing | Weight Per Foot | Setting Depth | Sacks Cement | Cement Bot | Cement Top | Status |
|-------------|--------------|----------------|-----------------|---------------|--------------|------------|------------|--------|
| SURF | 12+1/4 | 8+5/8 | 24 | 315 | 215 | 315 | 0 | VISU |
| 1ST | 7+7/8 | 4+1/2 | 15.10 | 7,300 | 250 | 7,300 | 6,080 | CBL |

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6953 with 2 sacks cmt on top. CIPB #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 135 sacks. Leave at least 100 ft. in casing 2400 CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 340 sacks half in. half out surface casing from 855 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: ANGELA FIORE
Title: ENGINEERING TECHNICIAN Date: 8/14/2017 Email: ANGELA.FIORE@NBLENERGY.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: HICKEY, MIKE Date: 8/29/2017

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 2/27/2018

| COA Type | Description |
|-----------------|--|
| | 1) Submit Form 42 electronically to COGCC 48 hours prior to MIRU. 2) Properly abandon flowlines. Once flowlines are properly abandoned, file electronic form 42. 3) For 855 plug: After it has been verified all fluid migration (liquid or gas) has been eliminated, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours and tag plug – top of plug must be not deeper than 265' and provide minimum 10 sx plug at the surface. Leave at least 100' of cement in the wellbore for each plug. |
| | Prior to starting plugging operations a bradenhead test shall be performed. 1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required. 2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions, Appendix A: Liquid and Gas Sampling. The Form 17 shall be submitted within 10 days of the test. |

Attachment Check List

| Att Doc Num | Name |
|--------------------|-------------------------|
| 401374892 | FORM 6 INTENT SUBMITTED |
| 401374957 | WELLBORE DIAGRAM |

Total Attach: 2 Files

General Comments

| User Group | Comment | Comment Date |
|-------------------|--|---------------------|
| Engineer | added estimated casing cut depth to match WBD and plugging procedure | 08/29/2017 |
| Public Room | Document verification complete 08/21/17 | 08/21/2017 |
| Permit | Per operator corrected contact email. | 08/15/2017 |

Total: 3 comment(s)