

FORM
6
Rev
12/05

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 401174542			
Date Received: 12/28/2016			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.
A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: <u>69175</u>	Contact Name: <u>Kelsi Welch</u>
Name of Operator: <u>PDC ENERGY INC</u>	Phone: <u>(303) 831-3974</u>
Address: <u>1775 SHERMAN STREET - STE 3000</u>	Fax: _____
City: <u>DENVER</u> State: <u>CO</u> Zip: <u>80203</u>	Email: <u>kelsi.welch@pdce.com</u>
For "Intent" 24 hour notice required, Name: _____ Tel: _____	
COGCC contact: Email: _____	

API Number <u>05-123-20119-00</u>	Well Name: <u>SOLIS</u>	Well Number: <u>44-17</u>
Location: QtrQtr: <u>SESE</u> Section: <u>17</u> Township: <u>5N</u> Range: <u>64W</u> Meridian: <u>6</u>	County: <u>WELD</u> Federal, Indian or State Lease Number: _____	
Field Name: <u>WATTENBERG</u>	Field Number: <u>90750</u>	

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.394560 Longitude: -104.566060

GPS Data:
Date of Measurement: 06/03/2010 PDOP Reading: 1.8 GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: _____

Fish in Hole: Yes No If yes, explain details below

Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6822	6832	12/02/2016	B PLUG CEMENT TOP	6772

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	395	360	395	0	VISU
1ST	7+7/8	4+1/2	10.5	7,051	160	7,051	6,269	CBL
S.C. 1.1				2,915	225	6,269	2,915	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6772 with 2 sacks cmt on top. CIBP #2: Depth 6422 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 174 sks cmt from 710 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: 609 ft. 4+1/2 inch casing Plugging Date: 12/02/2016
of _____

*Wireline Contractor: Magna *Cementing Contractor: Bayou

Type of Cement and Additives Used: 15.8#/gal CI G cement

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Solis #44-17 (05-123-20119)/Plugging Procedure (Subsequent)
Producing Formation: Codell 6822'-6832'
TD: 7063' PBD: 7024'
Surface Casing: 8?" 24# @ 395' w/ 360 sks cmt.
Production Casing: 4 1/2" 10.5# @ 7051' w/ 385 sks cmt (TOC 2915' CBL).

Tubing: 2?" 4.7# EUE set at 6812'. (10/9/2001)

Proposed Procedure:

1. MIRU RU pulling unit. Pull tubing.
2. RU wireline company.
3. TIH with CIBP. Set bridge plug at 6772'. TIH with dump bailer. Spot 2 sxs cement on top of CIBP.
4. TIH with CIBP. Set bridge plug at 6422'. TIH with dump bailer. Spot 2 sxs cement on top of CIBP.
5. TIH with casing cutter. Cut 4 1/2" casing at 609'. Pull 4 1/2" casing.
6. TIH with tubing to 710'. Mix and pump 174 sxs of 15.8#/gal CI G cement to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kelsi Welch

Title: Production Tech Date: 12/28/2016 Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

CONDITIONS OF APPROVAL, IF ANY:

<u>COA Type</u>	<u>Description</u>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401174542	FORM 6 SUBSEQUENT SUBMITTED
401174546	WIRELINE JOB SUMMARY
401174548	CEMENT JOB SUMMARY
401174549	WELLBORE DIAGRAM

Total Attach: 4 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)