

Engineer: Trey Sloan
Cell Phone Number: 918-534-6637

PLUG and ABANDONMENT PROCEDURE

PLATTE 22-35

Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. Directional Survey was run on 05/19/07. RDMO Slickline.
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP. Unland tbg using unlanding joint and LD.
7. TOOH and SB 6875' 2-3/8" tbg. LD any remainder.
8. MIRU WL. PU and RIH with (4-1/2", 11.6#) gauge ring to 6885'. POOH.
9. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 6875' (collars at 6866' & 6898'). POOH. RDMO WL.
10. TIH with 2-3/8" tbg to 6875'
11. Load hole with biocide treated fresh water and circulate all gas out of well. PT CIBP to 1000psi for 15 minutes.
12. MIRU Cementers. Pump Niobrara Balance Plug: Pump 25 sx (6.9 bbl or 39 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 400' inside 4-1/2", 11.6# production casing with no excess. Cement will be from 6875'-6475'. RD Cementers.
13. Slowly pull out of the cement and TOOH. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, SB 1830' 2-3/8" tbg. LD remaining tbg.
14. MIRU WL. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 3935' (collars at 3912' & 3954'). POOH. RIH and dump 2 sx cement on CIBP. POOH.
15. Run CCL-GR-CBL-VDL from +/- 3935' to surface to confirm Fox Hills Squeeze location. Forward to Engineering. In addition to normal handling, of logs/job summaries, email copies of all cement job logs/job summaries and invoices to DJVendors@anadarko.com within 24 hours of completion of the job.
16. RIH and dump 2 sx cement on CIBP. POOH
17. RIH with two 3-1/8" perf guns with 3 spf, min 0.5" EHD, 120° phasing. Shoot 2' of squeeze holes at 2200' and 4' of squeeze holes at 1800'. RDMO WL.
18. PU and TIH with (4-1/2", 11.6#) CICR on 2-3/8" tbg while hydrotesting to 3000 psi. Set CICR at +/- 1830'.
19. Establish circulation to surface with biocide treated fresh water and pump 75 bbls to clean up hole.
20. MIRU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Fox Hills GasBlok Squeeze: 170 sx (35.1 bbls, 197.2 cf) with 0.25 lb/sk polyflake, assuming 15.8 ppg and 1.16 yld. Underdisplace by 3 bbls. Volume is based on 370' below the CICR inside 4-1/2", 11.6# production casing with no excess, 400' in the 4-1/2" annulus assuming 7.88" bit size and 60% excess and 188' on top of the CICR to cover top perfs. RD Cementers.
21. Slowly pull out of cement and reverse circulate to ensure no cement is left in the tbg. TOOH and SB 930' of 2-3/8" tbg, LD remaining tbg.
22. If gas migration has stopped. MIRU WL. RIH and jet cut 4-1/2", 11.6# casing at 830'. RDMO WL.
23. Attempt to establish circulation and circulate (59 bbl) with fresh water containing biocide to remove any gas.
24. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.

25. Install BOP on casing head with 4-1/2", 11.6# pipe rams.
26. TOOH and LD all 4-1/2", 11.6# casing. Remove 4-1/2", 11.6# pipe rams and install 2-3/8" pipe rams.
27. TIH with mule shoe and 2-3/8" tubing to 930'.
28. Establish circulation to surface with biocide treated fresh water and pump at least two hole-volumes (121 bbl) to circulate all gas out of the well. Contact engineering if evidence of gas migration persists.
29. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump GAS BLOK Stub Plug: 130 sx (26.9 bbl or 151 cf) with 0.25 lb/sk Polyflake, assuming 15.8 ppg & 1.16 cf/sk. Volume is based on 100' in 4-1/2", 11.6# production casing with no excess, 103' in 7.88" bit size with 100% excess factor, and 202' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 930'-525'. RDMO Cementers. Notify engineering if circulation is ever lost during job.
30. Slowly pull out of the cement and TOOH to 100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, LD all 2-3/8" tbg.
31. MIRU WL. Tag cement as needed. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
32. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
33. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
34. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
35. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
36. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
37. Welder cut casing minimum 5' below ground level.
38. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
39. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
40. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
41. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
42. Back fill hole with fill. Clean location, and level.
43. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.