

Interim Reclamation and Stormwater Inspection

November 22, 2017

Operator: KERR MCGEE OIL & GAS ONSHORE LP #47120

Location ID: 448228

Weld County, CO

SWSE Section 2 T1N R67W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos
Location Name: BURGE /27C-2HZ
Location ID: 448228



Photo 1. Photo taken from the entrance of the location, facing West. Tracking pad device has been installed. May need maintenance to ensure BMP is in proper functioning condition.



Photo 2. Photo taken from the southeast location, facing West. Sediment trap installed with a stabilized outlet. Embankment berms of sediment trap have not been properly compacted.

Inspection Photos
Location Name: BURGE /27C-2HZ
Location ID: 448228



Photo 3. Photo taken from the eastern location, facing North. Appears topsoil has been salvaged and stored along the eastern perimeter. Does not appear topsoil has been properly tracked with equipment. Equipment tracking should be up and down the slope to reduce potential erosion. Ditch and berm BMP installed around the perimeter of the location.



Photo 4. Photo taken from the northeast location, facing North. See comments under Photo 2.

Inspection Photos
Location Name: BURGE /27C-2HZ
Location ID: 448228



Photo 5. Photo taken from the northeast location, facing East. See comments under Photo 2.



Photo 6. Photo taken from the northeast location, facing West. Ditch and berm BMP installed around the perimeter of the location. Appears portions of the berm have been tracked with equipment for temporary stabilization but portions have been left unconsolidated.

Inspection Photos
Location Name: BURGE /27C-2HZ
Location ID: 448228



Photo 7. Photo taken from the northern location, facing West. See comments under Photo 6.



Photo 8. Photo taken from the western location, facing South. See comments under Photo 6.

Inspection Photos
Location Name: BURGE /27C-2HZ
Location ID: 448228



Photo 9. Photo taken from the southwestern location, facing East. See comments under Photo 6. Operator shall minimize equipment traffic on BMPs to ensure BMP is in proper functioning condition.



Photo 10. Photo taken from the southeastern location, facing East. See comments under Photo 6. Culvert has been installed in conjunction with the ditch BMP.