

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401475285

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: O'Donnell, Shaun

Tel: (720) 305-8280

COGCC contact:

Email: shaun.odonnell@state.co.us

API Number 05-123-20104-00

Well Name: EDWARDS

Well Number: 33-9

Location: QtrQtr: NWSE Section: 9 Township: 5N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.412250

Longitude: -104.895560

GPS Data:

Date of Measurement: 03/15/2007

PDOP Reading: 2.1

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 1375

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7709	7732			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	448	320	448	0	VISU
1ST	7+7/8	4+1/2	11.6	7,900	250	7,900	6,404	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7659 with 2 sacks cmt on top. CIPB #2: Depth 6855 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 830 sks cmt from 1425 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Edwards 33-9 (05-123-20104)/Plugging Procedure (Intent)  
Producing Formation (Perforations): J-Sand: 7709'-7732'  
TD: 7953' PBD: 7886'  
Surface Casing: 8 5/8" 24# @ 448' w/ 320 sxs  
Production Casing: 4 1/2" 11.6# @ 7900' w/ 250 sxs cmt (TOC @ 6404' - CBL).

Tubing: 2 3/8" tubing set @ 7695' (3/20/2001).

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.

2. RU wireline company.

3. TIH with CIBP. Set BP at 7659'. Top with 2 sxs 15.8#/gal CI G cement.

4. TIH with CIBP. Set BP at 6855'. Top with 2 sxs 15.8#/gal CI G cement.

5. TIH with casing cutter. Cut 4 1/2" casing at 1375'. Pull cut casing.

6. TIH with tubing to 1425'. RU cementing company. Mix and pump 830 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.

7. Cut surface casing 6' below ground level and weld on cap.

If there is bradenhead pressure:

1. MIRU pulling unit. Pull 2 3/8" tubing.

2. RU wireline company.

3. TIH with CIBP. Set BP at 7659'. Top with 2 sxs 15.8#/gal CI G cement.

4. TIH with CIBP. Set BP at 6855'. Top with 2 sxs 15.8#/gal CI G cement.

5. TIH with casing cutter. Cut 4 1/2" casing at 1500'. Pull cut casing.

6. TIH with tubing to 1550'. RU cementing company. Mix and pump 75 sxs 15.8#/gal CI G cement down tubing. Wait 8 hours or overnight. Check to see if there is any bradenhead pressure or fluid flow after stub plug is set. If there is, contact COGCC for further guidance. If there is not, move on to the next step.

7. TIH with tubing to 1375'. RU cementing company. Mix and pump 950 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.

8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_

Print Name: Jenifer Hakkarinen

Title: Reg Tech

Date: \_\_\_\_\_

Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

401475303	WELLBORE DIAGRAM
401475304	WELLBORE DIAGRAM
401475305	GYRO SURVEY

Total Attach: 3 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)