

Document Number:
401477854

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Kelsi Welch
 Name of Operator: PDC ENERGY INC Phone: (303) 831-3974
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: kelsi.welch@pdce.com

For "Intent" 24 hour notice required, Name: O'Donnell, Shaun Tel: (720) 305-8280
 COGCC contact: Email: shaun.odonnell@state.co.us

API Number 05-123-13061-00 Well Number: 1
 Well Name: BLACK GOLD PETROLEUM
 Location: QtrQtr: SWSW Section: 10 Township: 6N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: 55801
 Field Name: EATON Field Number: 19350

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.497222 Longitude: -104.770833
 GPS Data:
 Date of Measurement: 01/18/2010 PDOP Reading: 2.0 GPS Instrument Operator's Name: Brandon Lucason
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 500
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7312	7320			
NIOBRARA	7053	7226			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	292	250	292	0	
1ST	7+7/8	4+1/2	11.6	7,390	225	7,390	6,376	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7003 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 295 sks cmt from 550 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Black Gold Petroleum 1 (05-123-13061)/Plugging Procedure (Intent)
Producing Formation (Perforations): Niobrara: 7053'-7226' Codell: 7312'-7320'
TD: 7400' PBTD: 7370'
Surface Casing: 8 5/8" 24# @ 292' w/ 250 sxs
Production Casing: 4 1/2" 11.6# @ 7390' w/ 225 sxs cmt (TOC @ 6376' - CBL).

Tubing: 2 3/8" tubing set @ 7281' (10/30/2000).

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 7003'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with casing cutter. Cut 4 1/2" casing at 500'. Pull cut casing.
5. TIH with tubing to 550'. RU cementing company. Mix and pump 295 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.
If there is bradenhead pressure:
 1. MIRU pulling unit. Pull 2 3/8" tubing.
 2. RU wireline company.
 3. TIH with CIBP. Set BP at 7003'. Top with 2 sxs 15.8#/gal CI G cement.
 4. TIH with casing cutter. Cut 4 1/2" casing at 1500'. Pull cut casing.
 5. TIH with tubing to 1550'. RU cementing company. Mix and pump 75 sxs 15.8#/gal CI G cement down tubing. Wait 8 hours or overnight. Check to see if there is any bradenhead pressure or fluid flow after stub plug is set. If there is, contact COGCC for further guidance. If there is not, move on to the next step.
 6. TIH with tubing to 500'. RU cementing company. Mix and pump 350 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
 7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Kelsi Welch

Title: Production Tech

Date: _____

Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

<u>COA Type</u>	<u>Description</u>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401477867	WELLBORE DIAGRAM
401477869	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)