

FORM  
6Rev  
12/05

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401472899

Date Received:

12/01/2017

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CANDICE BARBER

Name of Operator: KERR MCGEE OIL &amp; GAS ONSHORE LP

Phone: (970) 515-1671

Address: P O BOX 173779

Fax:

City: DENVER State: CO Zip: 80217-

Email: CANDICE.BARBER@ANADARKO.CO  
M

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-19163-00

Well Name: HSR-NELSON

Well Number: 15-32A

Location: QtrQtr: SWSE Section: 32 Township: 3N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.176680

Longitude: -104.911130

GPS Data:

Date of Measurement: 04/13/2008

PDOP Reading: 2.5

GPS Instrument Operator's Name: Cody Mattson

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 890

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7312	7322			
J SAND	7748	7790			
NIOBRARA	7112	7114			

Total: 3 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	23	620	435	620	0	VISU
1ST	7+7/8	4+1/2	11.6	7,452	145	7,452	6,610	CBL
S.C. 1.1				7,452	340	4,518	3,840	CBL
1ST LINER	3+7/8	2+7/8	6.5	7,909	35	7,909	7,387	CBL

### Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7375 with 2 sacks cmt on top. CIPB #2: Depth 7060 with 25 sacks cmt on top.  
 CIBP #3: Depth 3960 with 2 sacks cmt on top. CIPB #4: Depth 80 with 25 sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 7060 ft. to 6655 ft. Plug Type: CASING Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 180 sacks half in. half out surface casing from 990 ft. to 570 ft. Plug Tagged: ☒

Set 25 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CANDICE BARBER  
 Title: REGULATORY ANALYST Date: 12/1/2017 Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: McCoy, Diane Date: 1/11/2018

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_ Expiration Date: 7/10/2018

<b>COA Type</b>	<b>Description</b>
	1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) Properly abandon all flowlines as per Rule 1103. File electronic Form 42 once abandonment complete. 3) Operator shall implement measures to control unnecessary and excessive venting, to protect the health and safety of the public, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare. 4) Please submit gyro survey data with Form 6 Subsequent Report of Abandonment. 5) If there is pressure or evidence of gas migration after placing the CIBP at 3960', do not pump the stub plug and shoe plug as one plug. Contact COGCC engineering for an update to the plugging procedure. Leave at least 100' of cement in the wellbore for each plug.
	Prior to starting plugging operations a bradenhead test shall be performed. 1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required. 2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. The Form 17 shall be submitted within 10 days of the test. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.

### **Attachment Check List**

<b>Att Doc Num</b>	<b>Name</b>
401472899	FORM 6 INTENT SUBMITTED
401472902	PROPOSED PLUGGING PROCEDURE
401472903	WELLBORE DIAGRAM

Total Attach: 3 Files

### **General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>
Public Room	Document verification complete 12/08/17	12/08/2017

Total: 1 comment(s)