

Engineer: David Hasz  
Cell Phone Number: 970-371-8820

## PLUG and ABANDONMENT PROCEDURE

### MILLER ESTATE 08-13K

#### Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run on 02/16/13. RDMO Slickline.
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a min of 25 jts of 2-3/8" 4.7#, J-55, EUE tbg. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP. Unland tbg using unlanding joint and LD.
7. TOOH and SB 7070' 2-3/8" tbg. LD any remainder.
8. PU and TIH with (4-1/2", 11.6#) Bit and Scraper on 2-3/8" tbg to 7080'. TOOH, SB all 2-3/8" tbg. LD Bit and Scraper.
9. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 7070' (collars at 7046' & 7089'). POOH. RIH and dump 2 sx cement on CIBP. POOH. RDMO WL.
10. TIH with 2-3/8" tbg to 7070'. Load hole with biocide treated fresh water and circulate all gas out of well. TOOH and SB 2-3/8" tbg.
11. MIRU WL. RIH and run CBL from 7070' to surface. Forward CBL to Platteville office. Cementing plans may change depending on CBL results. RDMO WL. MIRU hydrotesters. TIH with 2-3/8" tbg to 7070' while hydrotesting to 3000 psi. RDMO hydrotesters. PT CIBP to 1000psi for 15 minutes.
12. MIRU WL. PU and RIH with two 3-1/8" perf guns with 3 spf, min 0.5" EHD, 120° phasing. Shoot 2' of squeeze holes at 6800' and 4' of squeeze holes at 6400'. RDMO WL.
13. PU and TIH with (4-1/2", 11.6#) CICR on 2-3/8" tbg. Set CICR at 6430'.
14. Establish circulation to surface with biocide treated fresh water, and pump 100 bbls to clean up hole.
15. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Niobrara Squeeze: 115 sx (36.7 bbl or 206 cf) TXI cement with 0.25 lb/sk polyflake, assuming 12 ppg & 1.79 cf/sk. Underdisplace by 3 bbls. Volume is based on 370' below the CICR inside 4-1/2", 11.6# production casing with no excess, 400' in the 4-1/2", 11.6# annulus assuming 7.88" bit size with 60% excess and 190' on top of the CICR to cover top perfs. RD Cementers.
16. Slowly pull out of the cement and TOOH to 5740'. Reverse circulate to ensure no cement is left in the tbg.
17. TOOH and SB 4135' of 2-3/8" tbg. LD remaining tbg.

18. MIRU WL. PU and RIH with two 3-1/8" perf guns with 3 spf, min 0.5" EHD, 120° phasing. Shoot 2' of squeeze holes at 4510' and 4' of squeeze holes at 4105'. RDMO WL.
19. PU and TIH with (4-1/2", 11.6#) CICR on 2-3/8" tbg. Set CICR at 4135'.
20. Establish circulation to surface with biocide treated fresh water, and pump 100 bbls to clean up hole.
21. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Sussex Squeeze: 115 sx (36.7 bbl or 206 cf) TXI cement with 0.25 lb/sk polyflake, assuming 12 ppg & 1.79 cf/sk. Max pump pressure at surface is to be 722 psi. Underdisplace by 3 bbls. Volume is based on 375' below the CICR inside 4-1/2", 11.6# production casing with no excess, 405' in the 4-1/2", 11.6# annulus assuming 7.88" bit size with 60% excess and 190' on top of the CICR to cover top perms. RD Cementers.
22. Slowly pull out of the cement and TOO H to 3445'. Reverse circulate to ensure no cement is left in the tbg.
23. TOO H and SB 1190' of 2-3/8" tbg. LD stinger, and remaining tbg.
24. MIRU WL. RIH and jet cut 4-1/2", 11.6# casing at 1090'. RDMO WL.
25. Attempt to establish circulation and circulate (100 bbl) with fresh water containing biocide to remove any gas.
26. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
27. Install BOP on casing head with 4-1/2", 11.6# pipe rams.
28. TOO H and LD all 4-1/2", 11.6# casing. Remove 4-1/2", 11.6# pipe rams and install 2-3/8" pipe rams.
29. TIH with mule shoe and 2-3/8" tubing to 1190'.
30. Establish circulation to surface with biocide treated fresh water and pump at least two hole-volumes (207 bbl) to circulate all gas out of the well. Contact engineering if evidence of gas migration persists.
31. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Stub Plug: 410 sx (84 bbl or 472 cf) TXI cement with 0.25 lb/sk Polyflake, assuming 14 ppg & 1.15 cf/sk. Volume is based on 100' in 4-1/2", 11.6# production casing with no excess, 570' in 7.88" bit size with 100% excess factor, and 200' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 1190'-320'. RDMO Cementers. Notify engineering if circulation is ever lost during job.
32. Slowly pull out of the cement and TOO H to 100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOO H, LD all 2-3/8" tbg.
33. MIRU WL. Tag cement as needed. After tagging top of cement, and verifying appropriate coverage above the surface casing shoe, pressure test surface casing to 500 psi and hold for 15 minutes.
34. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
35. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
36. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
37. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.

38. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
39. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
40. Welder cut casing minimum 5' below ground level.
41. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
42. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
43. Obtain GPS location data as per COGCC Rule 215 and send to [rscDJVendors@anadarko.com](mailto:rscDJVendors@anadarko.com).
44. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
45. Back fill hole with fill. Clean location, and level.
46. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.