



## **Plug to Abandon Procedure**

**Well Name: Stites 21-5**

# SUMMARY

---

**WELL NAME:** Stites 21-5  
**API #** 05-077-09366-00  
**DESCRIPTION / OBJECTIVE:** MIRU Service rig to Plug to Abandon wellbore.

## **WELL INFORMATION**

**Surface Location:** Section 20, T9S, R94W  
1464' FNL & 913' FEL  
Mesa County, CO

**Perforations** None

**Casing Program** Surface – 8 5/8” 32 lb/ft J-55 at 1510’ (TOC @ Surface)  
Production - 4½” 11.6 lb/ft I-80 at 7215’ (TOC @ 385’)

**Tubing** None

**Elevation:** GL: 6664’ RKB: 20’ KB

**PROCEDURE:**

	<b>P&amp;A Procedure:</b>	All cement to be neat class G @ 15.8 ppg	#SX
1	Plug Base Wasatch	Balance 200 foot cement plug in 4-1/2 @ 3212-3412	16
2	Plug Surface Shoe	Balance 100 foot cement plug in 4-1/2 @ 1460-1560	8
3	Plug Surface	Shoot 4 holes at 100 Balance 100 foot cement plug inside and out 4-1/2 @ 0-100	28
4	Surface Marker	Cut off casing 3-4' below GL Install abandonment marker over SHL as per COGCC regulations. The following minimum information shall be permanently placed on the marker with a plate beaded on by welding: Operator name Lease number Well name and number API number Location by ¼ ¼ Section, Township and Range.	

## CONTACTS:

### Completions Manager

John Grubich – 970-589-9496 (c)  
970-812-5312 (o)

### Production Manager

Milt Johnson – 970-230-1011

### Production Superintendent

TJ Cordova – 970-250-9519

### Senior Regulatory Manager

Wayne Bankert -970-985-5383

### Completion Consultant

Dan Hacking – 970-778-1063

### COGCC

Curtis Conklin - 970-487-3888

Craig Burger - 970-625-2497