

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401507403

Date Received:

01/09/2018

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Narayan (Sonu) Choudhary

Name of Operator: NOBLE ENERGY INC

Phone: (720) 939-2574

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: narayan.choudhary@nblenergy.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-24353-00

Well Name: LAMP H

Well Number: 25-31

Location: QtrQtr: NENE Section: 26 Township: 3N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.199900

Longitude: -104.621820

GPS Data:

Date of Measurement: 11/29/2006

PDOP Reading: 2.6

GPS Instrument Operator's Name: PAUL TAPPY

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 922

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7137	7148			
NIOBRARA	6896	6912			

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	722	300	722	0	VISU
1ST	7+7/8	4+1/2	11.60	7,278	640	7,278	3,578	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6846 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 4650 ft. to 4000 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 165 sacks. Leave at least 100 ft. in casing 2400 CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 310 sacks half in. half out surface casing from 972 ft. to 12 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Diane Blair

Title: Engineering Technician Date: 1/9/2018 Email: diane.blair@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 2/6/2018

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 8/5/2018

<b>COA Type</b>	<b>Description</b>
	<p>DUE TO REPORTED HIGH BRADENHEAD PRESSURE:</p> <p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) The plug at 2400' needs to be placed and have an 8 hour WOC to assure that all fluid migration has been stopped. If that doesn't isolate the flow, additional attempts in front of the surface shoe plug will need to be attempted. Other downhole potential squeeze opportunities may need to be looked at before the 858' plug.</p> <p>3) Prior to placing the 972' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders.</p> <p>4) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 672' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug.</p> <p>5) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment is complete.</p>
	<p>Prior to starting plugging operations a Bradenhead test shall be performed.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>3) If sampling is required contact COGCC engineering for an confirmation of plugging requirements prior to placing any plugs.</p> <p>Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. The Form 17 shall be submitted within 10 days of the test.</p>

### **Attachment Check List**

<b><u>Att Doc Num</u></b>	<b><u>Name</u></b>
401507403	FORM 6 INTENT SUBMITTED
401507416	WELLBORE DIAGRAM
401507417	WELLBORE DIAGRAM

Total Attach: 3 Files

### **General Comments**

<b><u>User Group</u></b>	<b><u>Comment</u></b>	<b><u>Comment Date</u></b>
Engineer	<p>1) Deepest Water Well within 1 mile = 600'.</p> <p>2) Fox Hills Bottom- 607', per SB5.</p>	02/06/2018
Engineer	Operator shall implement measures to control unnecessary and excessive venting, to protect the health and safety of the public, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.	02/06/2018
Public Room	Document verification complete 01/26/18	01/26/2018

Total: 3 comment(s)