

Interim Reclamation and Stormwater Inspection

February 6, 2018

Operator: BARRETT CORPORATION* BILL - #10071

Location ID: 452726

Inspection Document #: 682403296

Weld County, CO

SWSW Section 27 T5N R61W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO

Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos
Location Name: Anschutz-Williams /5-61-27 SWSW
Location ID: 452726



Photo 1. Photo taken from one of the wellheads at location on January 12, 2018. Photo illustrates a rat hole left open. This is a potential safety and wildlife hazard. Operator should also consider placing safety fence around the wellhead area for safety measures.



Photo 2. Photo taken from the wellheads at location on February 6, 2018. Operator has backfilled rat holes.

Inspection Photos
Location Name: Anschutz-Williams /5-61-27 SWSW
Location ID: 452726



Photo 3. Photo taken from the southeastern perimeter of the location on January 12, 2018, facing West. Operator needs to store/handle sawdust left at location because it is blowing off location. Comments from Photo 5 apply to this area as well.



Photo 4. Photo taken from the southeastern perimeter of the location on February 6, 2018, facing West. Portions of the southern perimeter remain unconsolidated and needs to be stabilized. Operator plans to stabilize the outer perimeter disturbance with hydromulch to prevent wind erosion.

Inspection Photos
Location Name: Anschutz-Williams /5-61-27 SWSW
Location ID: 452726



Photo 5. Photo taken from the northeast perimeter of the location on January 12, 2018, facing South. Operator does not have sufficient stormwater BMPs along the perimeter of the location.



Photo 6. Photo taken from the northeast perimeter of the location on February 6, 2018, facing West. See comments under Photo 4.

Inspection Photos
Location Name: Anschutz-Williams /5-61-27 SWSW
Location ID: 452726



Photo 7. Photo taken from the northwest perimeter of the location on January 12, 2018, facing East. Straw wattle BMP has been installed and appears hydromulch has been applied to portions of unconsolidated soil material along the perimeter of the location.



Photo 8. Photo taken from the northwest perimeter of the location on February 6, 2018, facing East. Operator has re-tracked fill slopes and applied more hydromulch. Operator plans to stabilize the outer perimeter disturbance with hydromulch to prevent wind erosion.

Inspection Photos

Location Name: Anschutz-Williams /5-61-27 SWSW

Location ID: 452726



Photo 9. Photo taken from the western perimeter of the location on February 6, 2018, facing South. Pipeline installation is in-process and appears to have compromised portions of the perimeter straw wattle BMPs. Operator shall work with the Pipeline company to ensure stormwater BMPs are maintained at all times.