

Document Number:  
401534631

Date Received:  
02/02/2018

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000 Fax: \_\_\_\_\_

City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

**For "Intent" 24 hour notice required,** Name: Duran, Alicia Tel: (970) 370-1281

**COGCC contact:** Email: alicia.duran@state.co.us

API Number 05-123-20863-00

Well Name: BAKER Well Number: 32-5

Location: QtrQtr: SWNE Section: 5 Township: 4N Range: 63W Meridian: 6

County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_

Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon       Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.344140 Longitude: -104.459920

GPS Data:  
Date of Measurement: 05/01/2008 PDOP Reading: 1.9 GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_

Casing to be pulled:  Yes  No Estimated Depth: \_\_\_\_\_

Fish in Hole:  Yes  No If yes, explain details below

Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below

Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7040	7085			

Total: 1 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	705	510	705	0	VISU
1ST	7+7/8	4+1/2	10.5	7,475	280	7,475	6,206	CBL
S.C. 1.1				7,475	380	6,206	0	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6990 with 2 sacks cmt on top. CIBP #2: Depth 6302 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 75 sks cmt from 905 ft. to 0 ft. Plug Type: CASING Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)  
Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged:   
Set \_\_\_\_\_ sacks at surface  
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_  
\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
Type of Cement and Additives Used: \_\_\_\_\_  
Flowline/Pipeline has been abandoned per Rule 1103  Yes  No \*ATTACH JOB SUMMARY

#### Technical Detail/Comments:

Baker 32-5 (05-123-20863)/Plugging Procedure (Intent)  
Producing Formation (Perforations): J-Sand: 7040'-7085'  
TD: 7501' PBD: 7393'  
Surface Casing: 8 5/8" 24# @ 705' w/ 510 sxs  
Production Casing: 4 1/2" 10.5# @ 7475' w/ 660 sxs cmt (TOC @ Surface - CBL).

Tubing: 2 3/8" tubing set @ 7031' (8/19/2002).

#### Proposed Procedure:

1. Run Gyro Survey.
2. MIRU pulling unit. Pull 2 3/8" tubing.
3. RU wireline company.
4. TIH with CIBP. Set BP at 6990'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with CIBP. Set BP at 6302'. Top with 2 sxs 15.8#/gal CI G cement.
6. TIH with tubing to 905'. RU cementing company. Mix and pump 75 sxs 15.8#/gal CI G cement down tubing.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen  
Title: Reg Tech Date: 2/2/2018 Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE Date: 2/28/2018

COA Type	Description
	1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) Prior to placing the 905' plug: verify that all fluid migration (liquid or gas) has been eliminated. If evidence of fluid migration or pressure remains, contact COGCC Engineer for an update to plugging orders. 3) After isolation has been verified, pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 655' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug. 4) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment is complete.
	Operator shall implement measures to control unnecessary and excessive venting, to protect the health and safety of the public, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	Prior to starting plugging operations a Bradenhead test shall be performed. 1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required. 2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required. 3) If sampling is required contact COGCC engineering for an confirmation of plugging requirements prior to placing any plugs. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. The Form 17 shall be submitted within 10 days of the test.

**Attachment Check List**

Att Doc Num	Name
401534631	FORM 6 INTENT SUBMITTED
401534634	WELLBORE DIAGRAM
401534635	WELLBORE DIAGRAM

Total Attach: 3 Files

**General Comments**

User Group	Comment	Comment Date
Engineer	1) Deepest Water Well within 1 mile = 660'. 2) Fox Hills Bottom- 221', per SB5.	02/28/2018
Permit	pass	02/20/2018
Public Room	Document verification complete 06/27/17	02/15/2018

Total: 3 comment(s)