

FORM

6

Rev  
12/05

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

401558581

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Sonu Choudhary

Name of Operator: NOBLE ENERGY INC

Phone: (720) 939-2574

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: narayan.choudhary@nblenergy.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-17494-00

Well Name: UPRC

Well Number: 13-10J

Location: QtrQtr: NWSE Section: 13 Township: 3N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.223100

Longitude: -104.610080

GPS Data:

Date of Measurement: 07/13/2006

PDOP Reading: 5.2

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 884

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7156	7168			
NIOBRARA	6872	7021			
SUSSEX	4500	4516	06/12/2002	SQUEEZED	

Total: 3 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	23	684	263	684	11	VISU
1ST	7+7/8	4+1/2	11.60	7,307	165	7,307	6,312	CBL
S.C. 1.1				4,516	350	4,516	3,772	CBL
S.C. 1.2				4,516	100	4,516	4,500	CALC

### Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6822 with 2 sacks cmt on top. CIPB #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 4650 ft. to 4000 ft. Plug Type: CASING Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 2500 ft. with 165 sacks. Leave at least 100 ft. in casing 2400 CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 300 sacks half in. half out surface casing from 934 ft. to 11 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing

Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_

\*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No

\*ATTACH JOB SUMMARY

Technical Detail/Comments:

STAGE CEMENT 1ST STRING 2 = CEMENT SQUEEZE TO AB SUSX

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_

Print Name: Diane Blair

Title: Engineering Technician

Date: \_\_\_\_\_

Email: diane.blair@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_

Expiration Date: \_\_\_\_\_

COA Type

Description

--	--

### Attachment Check List

Att Doc Num

Name

401558638	WELLBORE DIAGRAM
401558662	WELLBORE DIAGRAM

Total Attach: 2 Files

### General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	------------------------

Total: 0 comment(s)