

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

02/27/2018

Submitted Date:

02/28/2018

Document Number:

685304414**FIELD INSPECTION FORM**
 Loc ID 325300 Inspector Name: St John, William (Cal) On-Site Inspection ☐ 2A Doc Num:
Operator Information:OGCC Operator Number: 100264Name of Operator: XTO ENERGY INCAddress: 600 E EXCHANGE AVECity: FORTH WORTH State: TX Zip: 76164**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:7 Number of Comments2 Number of Corrective Actions☒ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
Beaty, Brent	505-330-3210	brent_beaty@xtoenergy.com	SW Inspection Reports
Woolley, Jeff	505-333-3222	Jeff_Woolley@xtoenergy.com	SW Inspection Reports
Trobaugh, Robert	505-333-3185	robert_trobaugh@xtoenergy.com	SW Inspection Reports

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
214515	WELL	PR	11/01/2017	GW	067-06118	SQUIRES 1	PR
412454	WELL	PR	12/06/2009	GW	067-09762	SQUIRES 4	PR

General Comment:

Inspection completed as routine follow up inspection.

This inspection does not alleviate requirement to complete any open corrective actions from previous inspections.

See link at end of report for path to downloadable pictures.

LocationOverall Good: ☐

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Good Housekeeping:

Type	UNUSED EQUIPMENT		
Comment:	Pipe, regulators, fittings, and busted wooden box in E perimeter of location.		
Corrective Action:	Remove equipment to comply with Rule 603.f.	Date:	03/31/2018

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Equipment:**

Type: Deadman # & Marked	# 8		corrective date
Comment:	Located (8) marked anchors corrective action completed.		
Corrective Action:		Date:	

Venting:

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type			
Comment:			
Corrective Action:		Date:	

Inspected Facilities									
Facility ID:	214515	Type:	WELL	API Number:	067-06118	Status:	PR	Insp. Status:	PR
Facility ID:	412454	Type:	WELL	API Number:	067-09762	Status:	PR	Insp. Status:	PR

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Check Dams	Fail	Gravel	Pass			
Gravel	Fail					
Rip Rap	Fail					
Ditches	Fail					
Berms	Pass	Compaction	Pass	Self Inspection	Fail	
Compaction	Fail					

Comment: It appear corrective actions from previous inspection have been performed but additional maintenance is required. The SW, W, and NW location fill slope has rilling, erosion channels, and gulley erosions. The erosion channels are 4"-18" wide and 4"-20" deep carrying stormwater and sediment off location. The fill slope remains fairly unstable creating erosion issues. Ditches, check dams, and rip rap have failed filling with sediment allowing them to be breeched and over run. The corrective action time is extended to allow for winter weather working conditions but repairs should be made as soon as possible to prevent further erosion damage.

Corrective Action: Install or repair required BMPs to comply with Rule 1002.f.

Date: 04/26/2018

Pits: ☐ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
401559021	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4389801
685304452	Inspection photos.	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4389799