

Construction and Stormwater Inspection

April 5, 2018

Operator: CAPTIVA ENERGY PARTNERS LLC- #10658

Location ID: 452112

Inspection Document #: 682403453

Weld County, CO

NENE Section 5 T3N R68W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos
Location Name: STILLROVEN FARM /PAD
Location ID: 452112



Photo 1. Photo taken from the northwestern well location on March 2, 2018, facing South. Operator has not installed the sediment trap in accordance with good engineering practices per Rule 1002.f.(2). Sediment trap side slopes are not stabilized, left unconsolidated. Sediment traps should not mix with ground water.



Photo 2. Photo taken from the northwestern well location on April 5, 2018, facing South. Appears the Operator built embankment berms and installed straw wattles, but did not stabilize the side slopes. Operator has encountered ground water which should not occur when installing a sediment trap.

Inspection Photos

Location Name: STILLROVEN FARM /PAD

Location ID: 452112



Photo 3. Photo taken from the northwestern well location on April 5, 2018, facing North. Photo illustrates unconsolidated side slopes and Operator has encountered ground water which should not occur when installing a sediment trap.

Inspection Photos
Location Name: STILLROVEN FARM /PAD
Location ID: 452112



Photo 4. Photo taken from the western well location on March 2, 2018, facing South. The berm BMP along the western location has not been properly stabilized. An unconsolidated berm BMP is not a proper functioning BMP, as the unconsolidated material becomes a source of potential pollution itself. Perimeter of the well location is approximately 60 feet from the adjacent reservoir.



Photo 5. Photo taken from the western well location on April 5, 2018, facing South. Appears the Operator has properly stabilized the western berm BMP.

Inspection Photos
Location Name: STILLROVEN FARM /PAD
Location ID: 452112



Photo 6. Photo taken from the entrance of the location on April 5, 2018, facing East. Appears the Operator has installed a tracking pad device along a portion of the location entrance. Appears there is a path along the tracking pad device with no BMPs.