

**FORM
INSP**

Rev
X/15

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

04/30/2018

Submitted Date:

05/01/2018

Document Number:

682503283

FIELD INSPECTION FORM

Loc ID 433129 Inspector Name: Trujillo, Aaron On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 10581
Name of Operator: ABILENE PERFECT ENERGY JV LLC
Address: 4600 PECOS STREET
City: DENVER State: CO Zip: 80211

Findings:

- 15 Number of Comments
- 9 Number of Corrective Actions
- Corrective Action Response Requested

Contact Information:

Contact Name	Phone	Email	Comment
Costa, Ryan		ryan.costa@state.co.us	
Kosola, Jason		jason.kosola@state.co.us	
		patricia@perfectenergy.us	
		almc@perfectenergy.us	
		dnr_cogcc_Engineering@state.co.us	
		dnr_cogccenforcement@state.co.us	
Freese, Steve		steve.freese@state.co.us	All SLB Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
433121	WELL	PR	12/01/2015	SI	073-06540	Surprise 12-54-36-6	SI

General Comment:

This is a follow-up interim reclamation and stormwater inspection to inspection doc. #689900063 and doc. #67313723. Any corrective action(s) from previous inspections that have not been addressed are still applicable. Due to outstanding corrective actions, this is being recommended for enforcement.

Location

Overall Good:

Signs/Marker:			
Type	OTHER		
Comment:	Previous inspections documented that the lease road sign located at CR 26 had incorrect operator information and required operator to install sign to comply with Rule 210.e. Signage located at lease road and CR 26 remains uncorrected. Corrective action has not been addressed; corrective action and corrective action date remains applicable. See photo 1 in the attached photo document.		
Corrective Action:	Install sign to comply with Rule 210.e.	Date:	10/10/2016
Type	WELLHEAD		
Comment:	At locked gate.		
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:	Previous inspections documented incomplete signage on two (2) tanks, with one (1) tank on the NE corner without any signage and required operator to install signage to comply with Rule 210.d. Signage remains incomplete and corrective action has not been addressed; corrective action and corrective action date remains applicable.		
Corrective Action:	Install sign to comply with Rule 210.d.	Date:	10/10/2016

Emergency Contact Number:		
Comment:	<input type="text"/>	
Corrective Action:	<input type="text"/>	Date: _____

Good Housekeeping:			
Type	UNUSED EQUIPMENT		
Comment:	Previous inspections documented unused equipment on the north side of the location and required it to be removed. Unused equipment remains. Corrective action has not been addressed; corrective action and corrective action date remains applicable. See photo 7 in the attached photo document.		
Corrective Action:	Comply with Rule 603.f	Date:	10/30/2017
Type	STORAGE OF SUPL		
Comment:	Previous inspections documented a pile of gravel on the location and required it to be removed. Gravel and various debris remains on and throughout location. Corrective action has not been addressed; corrective action and corrective action date remains applicable. See photo 17, 18, 20 and 22 in the attached photo document.		
Corrective Action:	Comply with Rule 603.f	Date:	10/30/2017

Overall Good:

Spills:			
Type	Area	Volume	
	WELLHEAD	<= 1 bbl	
Comment:	Previous inspections documented stained soil at wellhead and required operator to remove and/or remediate stained soil. Soils at wellhead have not been removed, or remediated. Stained soils can also be found in areas surrounding the well. See photos 19 and 21 in the attached photo document. Corrective action has not been addressed; corrective action and corrective action date remains applicable.		
Corrective Action:	Properly treat or dispose of oily waste in accordance with Rule 907.e. Contact area COGCC EPS		Date: 09/09/2017

In Containment: No

Comment:

Multiple Spills and Releases?

Tanks and Berms:					
Contents	#	Capacity	Type	Tank ID	SE GPS
	3		STEEL AST		38.961470,-103.399640
Comment:	Previous inspections documented that NFPA diamond labeling were missing on tanks. NFPA diamond labels remain missing from tanks. See Signs/Markers for corrective action				
Corrective Action:					Date:
Paint					
Condition					
Other (Content)					
Other (Capacity)					
Other (Type)					
Berms					
Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance	
Earth	Inadequate	Walls Insufficient	Base Insufficient	Adequate	
Comment:	Previous inspections documented insufficient and inadequate berms around the tanks, that the berm on the northwest end of the tanks has not been installed. Berms remain inadequate and missing. Corrective action has not been addressed; corrective action and corrective action date remains applicable.				
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 906.d(1).				Date: 09/09/2016
Venting:					
Yes/No					
Comment:					
Corrective Action:					Date:
Flaring:					
Type					
Comment:					
Corrective Action:					Date:

Inspected Facilities

Facility ID: 433121 Type: WELL API Number: 073-06540 Status: PR Insp. Status: SI

Idle Well

Purpose: Shut In Temporarily Abandoned Reminder: _____

Comment: Previous inspections required operator to perform MIT by 10/2015. No current MIT on record or delinquent as required by Rule 326. This corrective action has not been addressed and remains applicable.

Corrective Action: Perform MIT. Contact dnr_cogcc_Engineering@state.co.us with resolution plan.

Date: 10/01/2015

Reclamation - Storm Water - Pit

Interim Reclamation:

Date Interim Reclamation Started: _____ Date Interim Reclamation Completed: _____

Land Use: RANGELAND

Comment: _____

1002 SITE PREPARATION AND STABILIZATION

1002a. FENCING _____

Comment _____

Corrective Action _____

Date _____

1002b. SOIL REMOVAL AND SEGREGATION _____

Comment _____

Corrective Action _____

Date _____

1002c. PROTECTION OF SOILS _____

Comment _____

Corrective Action _____

Date _____

1002E. SURFACE DISTURBANCE MINIMIZATION _____

Comment _____

Corrective Action _____

Date _____

1003a. Waste and Debris removed? _____

Comment _____

Corrective Action _____

Date _____

Unused or unneeded equipment onsite? _____

Comment [See "Good Housekeeping"](#)

Corrective Action _____

Date _____

Pit, cellars, rat holes and other bores closed? _____

Comment _____

Corrective Action _____

Date _____

Guy line anchors marked? _____

Comment _____

Corrective Action _____

Date _____

1003b. Area no longer in use? _____ Production areas stabilized ? Fail

1003c. Compacted areas have been cross ripped? Fail

1003d. Drilling pit closed? _____ Subsidence over on drill pit? _____
 Cuttings management: _____

1003e. Areas no longer needed for drilling or subsequent operations for have been re-vegetated to 80% of pre-existing? Fail
 Production areas have been stabilized? Fail Segregated soils have been replaced? _____

RESTORATION AND REVEGETATION

Cropland

Top soil replaced _____ Recontoured _____ Perennial forage re-established _____

Non-Cropland

Top soil replaced _____ Recontoured _____ 80% Revegetation Fail

1003e. INTERIM VEGETATION TRANSECT
 TRANSECT RESULTS OF DISTURBED AREA% _____
 TRANSECT RESULTS OF REFERENCE AREA% _____
 TOTAL % OF DESIRABLE VEGETATION COVER _____
 VEGETATIVE COVER _____

1003 f. Weeds Noxious weeds? _____

Comment Previous inspections documented that the production area and location are not stabilized, that areas on the west side of the pad have eroded and degraded. It was also documented that vegetation in the interim areas have not adequately established and required operator to perform additional reclamation in accordance to 1003. Erosion degradation remains evident on the western areas of the pad/location. Large areas of the interim remain bare and exposed soil. In addition compaction concerns have also been identified. Corrective action has not been addressed; corrective action and corrective action date remains applicable. See photo 23-36 in the attached photo document.

Corrective Action Perform reclamation in accordance to COGCC 1003 series rules including, but not limited to, re-contouring and repairing eroded areas of the pad and location, compaction alleviation and establish vegetation with total perennial, non-invasive uniform plant cover of at least eighty (80) percent of pre-disturbance or reference area levels. Use a seed mixture requested by the surface owner, or a mixture prescribed by the local county NRCS. Ensure erosion controls are implemented to stabilize the seeded soil, and continue to monitor and manage this location.

Date 10/30/2017

Overall Interim Reclamation Fail

Final Reclamation/ Abandoned Location:

Date Final Reclamation Started: _____ Date Final Reclamation Completed: _____

Final Land Use: RANGELAND

Reminder: _____

Comment:

Well plugged _____ Pit mouse/rat holes, cellars backfilled _____

Debris removed _____ No disturbance /Location never built _____

Access Roads Regraded _____ Contoured _____ Culverts removed _____

Gravel removed _____

Location and associated production facilities reclaimed _____ Locations, facilities, roads, recontoured _____

Compaction alleviation _____ Dust and erosion control _____

Non cropland: Revegetated 80% _____ Cropland: perennial forage _____

Weeds present _____ Subsidence _____

1004.d. FINAL VEGETATION TRANSECT

TRANSECT RESULTS OF DISTURBED AREA% _____
 TRANSECT RESULTS OF REFERENCE AREA% _____
 TOTAL % OF DESIRABLE VEGETATION COVER _____
 VEGETATIVE COVER _____

Comment: _____

Corrective Action: _____

Date _____

Overall Final Reclamation

Well Release on Active Location

Multi-Well Location

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
	Fail		Fail			

Comment: Previous inspections documented erosion concerns to the southwest end of the wellhead and required erosion to be repaired, and stormwater and sediment control BMPs installed or repaired. Areas of erosion appears to have continued to worsen with further erosion encroachment onto the interim reclamation areas. Location remains unstabilized. In addition, the berm along the perimeter of the location has not been maintained and not in proper functioning condition; berm should have been reclaimed during interim reclamation. Corrective action has not been addressed; corrective action and corrective action date remains applicable. See photos 23-30 in the attached photo document.

Corrective Action: **Install or repair required BMPs per Rule 1002.f.**

Date: 09/09/2016

Pits: NO SURFACE INDICATION OF PIT

COGCC Comments

Comment	User	Date
A fence has been constructed across a section the access road without a gate. It is unclear as to why this has been done. Fence forces vehicle traffic to travel offroad to a gate in the corner of the fence just to the east. See photos 37-39.	trujilloam	05/01/2018

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
401625887	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4450423
682503284	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4450420