

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.
A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: _____ Tel: _____
 COGCC contact: Email: _____

API Number 05-123-23079-00 Well Name: DILLARD Well Number: 44-20
 Location: QtrQtr: SESE Section: 20 Township: 7N Range: 64W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.552890 Longitude: -104.565810
 GPS Data:
 Date of Measurement: 07/27/2006 PDOP Reading: 2.6 GPS Instrument Operator's Name: H.L. Tracy
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7145	7155	11/13/2017	B PLUG CEMENT TOP	7095

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	533	295	533	0	VISU
1ST	7+7/8	4+1/2	10.5	7,345	470	7,345	3,212	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7095 with 2 sacks cmt on top. CIBP #2: Depth 6790 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 313 sks cmt from 850 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: 750 ft. 4+1/2 inch casing Plugging Date: 11/13/2017
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: 15.8 PPG CL G NEAT

Flowline/Pipeline has been abandoned per Rule 1105 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Dillard 44-20 (05-123-23079)/Plugging Procedure
Producing Formation (Perforations): Codell: 7145'-7155'
TD: 7363' PBTD: 7306'
Surface Casing: 8 5/8" 24# @ 533' w/ 295 sxs
Production Casing: 4 1/2" 10.5# @ 7345' w/ 470 sxs cmt (TOC @ 3212' - CBL).

Tubing: 2 3/8" tubing set @ 7132' (2/21/2014).

Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 7095'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with CIBP. Set BP at 6790'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with casing cutter. Cut 4 1/2" casing at 750'. Pull cut casing.
6. TIH with tubing to 850'. RU cementing company. Mix and pump 308 sxs 15.8#/gal CI G cement down tubing. Cement circulate to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: REg TEch Date: 12/18/2017 Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

CONDITIONS OF APPROVAL, IF ANY:

<u>COA Type</u>	<u>Description</u>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401489114	FORM 6 SUBSEQUENT SUBMITTED
401489118	WELLBORE DIAGRAM
401489138	WIRELINE JOB SUMMARY
401489139	CEMENT JOB SUMMARY

Total Attach: 4 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)