

**Well Name: MALO 01**

API 05-123-05546	Original KB Elevation (ft) 4,847	Ground Elevation (ft) 4,842	Total Depth (ftKB) 6,684.0	Current PBTD (mKB)
Section 21	Township 8	Range 59	County/Parish WELD	State/Province COLORADO

**Casing Strings**

Csg Des	MD (ftKB)	Run Date	Prop Run?	Cut/Pull Date	Proposed Cut/Pull?	Depth Cut/Pull (ftKB)	OD (in)	ID (in)	Grade	Len (ft)
Surface	99.0	5/17/2018	No		No		8 5/8	8.10		94.00

**Tubing Strings**

Des	Set Depth (ftKB)	Run Date	Prop Run?	String Location	Pull Date	Prop Pull?	Cut/Pull Date	Proposed Cut/Pull?	Depth Cut/Pull (ftKB)

**Perforations**

Zone	Type	Date	Prop?	Top (ftKB)	Btm (ftKB)

**Other In Hole**

Des	Run Date	Prop Run?	Prop Pull?	Top (ftKB)	Btm (ftKB)

**Cement Stages**

Des	Type	Prop?	End Date	Top (ftKB)	Btm (ftKB)
Shoe Plug	Plug	Yes		5.0	100.0
Shoe Plug	Plug	Yes		100.0	1,200.0
Balance Plug	Plug	Yes		2,750.0	3,000.0
Balance Plug	Plug	Yes		5,750.0	6,000.0
Surface Casing Cement	Casing	No	5/6/1963	5.0	99.0
Shoe Plug	Plug	No	5/13/1963	50.0	100.0
Shoe Plug	Plug	No	5/13/1963	5.0	30.0

**P&A PROCESS**

Type Abandon	Sub Type WBI	Start Date 5/30/2018	Engineer Hunter Dunham	Cell Phone 281-253-6272
-----------------	-----------------	-------------------------	---------------------------	----------------------------

**PROCESS STEPS**

Type	Comment																												
1)	Survey and locate abandoned well, mark with stake and take location photos																												
2)	Excavate to expose top of surface casing																												
3)	Weld 2" collar to top of 8 5/8" surface casing cap. Make up to collar, pneumatic drill with non-sparking bit. Drill out cap venting possible trapped gas.																												
4)	Once verified that no gas exists beneath top of surface casing plate, cut off surface casing below plate with torch, dress up smooth.																												
5)	Butt weld 8 5/8" casing to dressed cut, bringing threaded end of casing to ground level.																												
6)	Make up to 8 5/8" casing, one 8 5/8" collar and 8 5/8" starter well head																												
7)	NU flange adaptor and 5K BOP, test BOP.																												
8)	NU and RIH with 7 7/8" cone bit, PU 6 1/4" drill collars, 4" workstring, and TIW valve																												
9)	Drill out first cement plug inside surface casing (TOC @ surface). Continue RIH to next plug (TOC @ 70'). Roll hole clean.																												
10)	Pressure test surface casing to 200 psi. If pressure bleeds off, set RBP and test again. **If test fails, contact office.**																												
11)	After pressure test of surface casing, drill out second cement plug from 70' to 100'																												
12)	Assume pressure under surface casing shoe, roll hole with kill fluid until well dead, or blow down.																												
13)	After pressure test of surface casing, continue RIH, cleaning out with drilling mud or water to 6000'																												
14)	Assume pressure under any plugs, roll hole with kill fluid until well dead, or blow down.																												
15)	TOOH with cone bit, drill collars, and workstring																												
16)	PU and RIH mule shoe, drill collars, and workstring to 6000'.																												
17)	Pressure test lines and pump 100sx of 15.8ppg Class G neat cement from 6000' to 5750'																												
	<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Interval Start</th> <th>Interval End</th> <th>Length (ft)</th> <th>Vol. Factor (ft^3/ft)</th> <th>Volume (ft^3)</th> <th>Yield (ft^3/sk)</th> <th>Cement (sxs)</th> </tr> </thead> <tbody> <tr> <td>6000</td> <td>5750</td> <td>250</td> <td>0.4418</td> <td>110</td> <td>1.15</td> <td>96</td> </tr> </tbody> </table>	Interval Start	Interval End	Length (ft)	Vol. Factor (ft^3/ft)	Volume (ft^3)	Yield (ft^3/sk)	Cement (sxs)	6000	5750	250	0.4418	110	1.15	96														
Interval Start	Interval End	Length (ft)	Vol. Factor (ft^3/ft)	Volume (ft^3)	Yield (ft^3/sk)	Cement (sxs)																							
6000	5750	250	0.4418	110	1.15	96																							
18)	Pull up to 3000' and pump 100sx of 15.8ppg Class G neat cement from 3000' to 2750'																												
	<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Interval Start</th> <th>Interval End</th> <th>Length (ft)</th> <th>Vol. Factor (ft^3/ft)</th> <th>Volume (ft^3)</th> <th>Yield (ft^3/sk)</th> <th>Cement (sxs)</th> </tr> </thead> <tbody> <tr> <td>3000</td> <td>2750</td> <td>250</td> <td>0.4418</td> <td>110</td> <td>1.15</td> <td>96</td> </tr> </tbody> </table>	Interval Start	Interval End	Length (ft)	Vol. Factor (ft^3/ft)	Volume (ft^3)	Yield (ft^3/sk)	Cement (sxs)	3000	2750	250	0.4418	110	1.15	96														
Interval Start	Interval End	Length (ft)	Vol. Factor (ft^3/ft)	Volume (ft^3)	Yield (ft^3/sk)	Cement (sxs)																							
3000	2750	250	0.4418	110	1.15	96																							
19)	Pull up to 1200' and pump 420sx of 15.8ppg Class G neat cement to surface																												
	<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Interval Start</th> <th>Interval End</th> <th>Length (ft)</th> <th>Vol. Factor (ft^3/ft)</th> <th>Volume (ft^3)</th> <th>Yield (ft^3/sk)</th> <th>Cement (sxs)</th> </tr> </thead> <tbody> <tr> <td>1200</td> <td>170</td> <td>1030</td> <td>0.3382</td> <td>348</td> <td>1.15</td> <td>363</td> </tr> <tr> <td>170</td> <td>0</td> <td>170</td> <td>0.3576</td> <td>61</td> <td>1.15</td> <td>53</td> </tr> <tr> <td colspan="6"></td> <td style="text-align: right;">416</td> </tr> </tbody> </table>	Interval Start	Interval End	Length (ft)	Vol. Factor (ft^3/ft)	Volume (ft^3)	Yield (ft^3/sk)	Cement (sxs)	1200	170	1030	0.3382	348	1.15	363	170	0	170	0.3576	61	1.15	53							416
Interval Start	Interval End	Length (ft)	Vol. Factor (ft^3/ft)	Volume (ft^3)	Yield (ft^3/sk)	Cement (sxs)																							
1200	170	1030	0.3382	348	1.15	363																							
170	0	170	0.3576	61	1.15	53																							
						416																							
20)	POOH with workstring. Wait 4 hrs, and tag TOC. If cement has fallen, top off back to surface																												
21)	Let cement set over night, verify cement has not settled and is still at surface. RDMO																												
22)	Excavate around wellhead to 8' below grade, cut off 8 5/8" casing, weld on cap																												
23)	Backfill hole and reclaim surface to original conditions																												