

State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:

401666066

Date Received:

06/07/2018

FIR RESOLUTION FORM

Overall Status: CAC

CA Summary:

2 of 2 CAs from the FIR responded to on this Form

2 CA Completed  
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 10000

Name of Operator: BP AMERICA PRODUCTION COMPANY

Address: 380 AIRPORT RD

City: DURANGO State: CO Zip: 81303

Contact Name and Telephone:

Name: \_\_\_\_\_

Phone: ( ) \_\_\_\_\_ Fax: ( ) \_\_\_\_\_

Email: \_\_\_\_\_

Additional Operator Contact:

Contact Name

Phone

Email

-

SanJuanCOGCC@bp.com

Beebe, Sabre

Sabre.Beebe@bp.com

COGCC INSPECTION SUMMARY:

FIR Document Number: 680602599

Inspection Date: 04/12/2018

FIR Submit Date: 04/23/2018

FIR Status: \_\_\_\_\_

Inspected Operator Information:

Company Name: BP AMERICA PRODUCTION COMPANY

Company Number: 10000

Address: 380 AIRPORT RD

City: DURANGO State: CO Zip: 81303

LOCATION - Location ID: 333510

Location Name: BONDAD 33-10-N33N10W Number: 2SENE County: LA PLATA

Qtrqtr: SENE Sec: 2 Twp: 33N Range: 10W Meridian: N

Latitude: 37.135642 Longitude: -107.897993

FACILITY - API Number: 05-067- -00 Facility ID: 259310

Facility Name: FRANK DAVIS B Number: 2

Qtrqtr: SENE Sec: 2 Twp: 33N Range: 10W Meridian: N

Latitude: 37.135642 Longitude: -107.897993

CORRECTIVE ACTIONS:

1 CA# 115999

Corrective Action: Revegetate the western portion of the project area.

Date: 05/31/2018

Response: CA COMPLETED

Date of Completion: 05/30/2018

Operator Comment: Seeding and mulching was performed on 5/30/18 on this location. Seeding was previously performed on 6/8/16 on this location as well.

COGCC Decision: \_\_\_\_\_

COGCC  
Representative:

2 CA# 116000

Corrective Action: Well pad stormwater diversion needs maintenance. Diversion outlet in the southwestern corner needs repair and replacement. Erosional channels and rilling along the access road needs to be stabilized. Stormwater controls along access need maintenance/repair and improvement to de-energize flows and capture sediment.

Date: 05/31/2018

Response: CA COMPLETED

Date of Completion: 05/30/2018

Operator Comment: Additional armouring of check dams was performed. A sediment trap installed where no process piping was in place. Run downs cleaned out and armoured and additional diversion installed on this location. See attached photos.

COGCC Decision:

COGCC  
Representative:

#### OPERATOR COMMENT AND SUBMITTAL

Comment: BP and Logos Resources collaborated to address storm water and vegetation issues on this location. Location was seeded in 2016 with little to no success. Reseeding was performed to meet COGCC request however with the current drought conditions in the SW area of Colorado the success of the seeding and mulching is likely to fail. Storm water corrective action was completed by installing additional silt traps, cleaning out of diversion ditches and installing additional armouring to the rock check dams to reduce velocity. See attached photos of work completed.

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Sabre Beebe

Signed:

Title: Compliance Specialist

Date: 6/7/2018 9:50:08 AM

#### ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

<u>Document Number</u>	<u>Description</u>
------------------------	--------------------

401666096	Work Completion photos
-----------	------------------------

Total Attach: 1 Files