

**FORM
INSP**

Rev
X/15

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

06/04/2018

Submitted Date:

06/07/2018

Document Number:

682600487

FIELD INSPECTION FORM

Loc ID _____ Inspector Name: Kosola, Jason On-Site Inspection
2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

OGCC Operator Number: 10626
Name of Operator: DOVER ATWOOD CORPORATION
Address: 1875 HARSH AVENUE SE
City: MASSILLON State: OH Zip: 44646

Findings:

- 3 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

Contact Information:

Contact Name	Phone	Email	Comment
Levengood, John	(330) 809-0630	jlevengood07@gmail.com	BACA Inspections
Crane, Rocky	(719) 529-0682	rockycrane@yahoo.com	
Ramos, Martha		martha.ramos@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
412232	PIPELINE	AC	05/04/1998		-	BACA GAS GATHERING SYSTEM 412232	EI

General Comment:

This is an environmental inspection. Any corrective actions from previous inspections that have not been addressed are still applicable.

Photos attached to document site at the time of inspection.

Some of the compressor facility has been removed from location. Compressor pipeline still present (see attached photos).

Please note inadequate netting on tank and inadequate berm around tank corrective actions.

Location

Overall Good:

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Overall Good:

Spills:

Type	Area	Volume			

In Containment: No

Comment:

Multiple Spills and Releases?

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
CRUDE OIL	1	200 BBLs	Open Top		37.207765,-102.294309

Comment: Corrective action #1 - Inadequate berms around tank.
Corrective action #2 - Netting on open tanks inadequate. Wildlife protection devices not adequate

Corrective Action: Repair or install berms or other secondary containment devices per Rule 605.a.(4). (Must be repaired within 30 days - July 8, 2018)
Install or repair wildlife protection equipment (10 days)

Date: 06/17/2018

Paint

Condition:

Other (Content) _____

Other (Capacity) _____

Other (Type) _____

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance

Comment:

Corrective Action:

Date:

Venting:

Yes/No

Comment:

Corrective Action:

Date:

Flaring:

Type <input type="text"/>	<input type="text"/>
Comment: <input type="text"/>	<input type="text"/>

Corrective Action:

Date:

Inspected Facilities

Facility ID: 412232 Type: PIPELINE API Number: - Status: AC Insp. Status: EI

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
682600488	Inspection photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4487687