

**FORM  
INSP**Rev  
X/15**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

06/19/2018

Submitted Date:

06/20/2018

Document Number:

682503514**FIELD INSPECTION FORM**Loc ID 433577 Inspector Name: Trujillo, Aaron On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**OGCC Operator Number: 96340Name of Operator: WIEPKING-FULLERTON ENERGY LLCAddress: 96 GLENMOOR LNCity: ENGLEWOOD State: CO Zip: 80113**Status Summary:**

- ☒
- THIS IS A FOLLOW UP INSPECTION
- 
- ☒
- FOLLOW UP INSPECTION REQUIRED
- 
- ☐
- NO FOLLOW UP INSPECTION REQUIRED

**Findings:**7 Number of Comments1 Number of Corrective Actions

- ☒
- Corrective Action Response Requested

**Contact Information:**

Contact Name	Phone	Email	Comment
Boone, Linda	(720) 271-8605	LDBoonePar@aol.com	<a href="#">All Inspections</a>
Herian, Tim	(316) 655-9200	therian1@cox.net	<a href="#">all inspections</a>
Halde, Kerry	(719) 340-0329	haldeoil@hotmail.com	<a href="#">All Inspections</a>

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
433578	WELL	PR	08/20/2013	OW	073-06543	Big Wampum 1	RI

**General Comment:**

This is a follow-up interim reclamation and stormwater inspection. Any corrective action(s) from previous inspections that have not been addressed are still applicable.

<b>Inspected Facilities</b>				
Facility ID: 433578	Type: WELL	API Number: 073-06543	Status: PR	Insp. Status: RI
<b>Producing Well</b>				
Comment:	IR inspection.			
Corrective Action:				Date:

**Reclamation - Storm Water - Pit****Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Waddles	Fail					Wattles, NW location
Berms	Fail					

Comment: Inspection #682503301 required operator to install stormwater and erosion control BMPs. Operator submitted FIRR #401656138 stating "Operator rebuilt the bank with topsoil, seeded, covered with straw blankets and rebuilt the berm on top. Area to north and east of the pump jack is fenced and water dams built on steep parts of the road". Work appears to have been conducted, however, BMPs do not appear to have been installed in accordance to good engineering practiced or maintained; straw wattles on the north end of the location have filled with sediment or are in disrepair. Soil was used to build "water dams" on the road. Water dams have not been consolidated, are not in proper functioning condition and is considered a sediment source.

Corrective Action: Install or repair required stormwater and erosion control BMPs in accordance to Rule 1002.f

Date: 07/20/2018

Pits: ☐ NO SURFACE INDICATION OF PIT

**Attached Documents**

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
682503515	Inspection Photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4500600">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4500600</a>