

Summary of Re-entry and Re-plugging Operations: KOOP 1

1. Survey and locate plugged wellbore. Set a stake and record as-drilled GPS coordinates.
2. Excavate around wellbore to expose the top of the surface casing.
3. Cut existing cap off wellbore. Weld a slip collar to 8-5/8" casing and necessary length of casing to reach ground level. Weld another 8-5/8" slip collar.
4. Install wellhead and BOP.
5. Drill out existing cement plugs with 6-1/2" bit. If potential collapsed casing does not allow a 6-1/2" bit through, downsize to smaller bit.
6. Continue RIH to fish at ~6200'. Tag fish and spot cement plug from 6200'-5900' with class G cement (98 sks). Tag plug once set.
7. Spot plug from 550' to surface with class G cement (185 sks).
8. Cut off casing 5' below surface and weld on a cap to seal the well.
9. Cover up the well and remediate the disturbed area.